



U.S. Department  
of Transportation

National Highway  
Traffic Safety  
Administration

400 Seventh Street, S.W.  
Washington, D.C. 20590

Dear Crash Data Researchers/Users:

Thank you for choosing crash data from the National Highway Traffic Safety Administration (NHTSA) for your research or other use. The information contained in this motor vehicle crash report is collected, maintained and distributed in accordance with Public Law 89-564. In accordance with this Public Law, NHTSA is required not to release any case information until completion of quality control procedures. These procedures include a review of the case material to extract all names, licenses and registration numbers, non-coded interview material, non-research related researcher comments in the margins, non-factual data, and the production number portion of the vehicle identification number (VIN).

If you requested NHTSA to query its database files in order to identify a specific crash, then that query was made using non-personal descriptors you provided for use in our search. This motor vehicle crash may have been identified from a data search and matches the general, non-personal descriptors you provided, but we cannot confirm that this is the specific crash report you requested.

If you have any questions with regard to the above procedures, please contact the Field Operations Branch, Crash Investigation Division, National Center for Statistics and Analysis at 202-366-4820. Again, please be advised that we cannot confirm that this is the case that you have specifically requested nor can we certify the information to be correct.

\*\*\*    \*\*\*    \*\*\*



AUTO SAFETY HOTLINE  
(800) 424-9393  
Wash. D.C. Area 366-0123

Case Vehicle (A): 1999 Volkswagen  
Type: Jetta, 4-door sedan  
Driver: 32-year-old male  
CDC: 06-BDEW-7, 01-FDEW-3

Vehicle (B): 1998 Dodge  
Type: Ram 1500, 4x4 pickup  
Driver: 27-year-old female  
CDC: 99-0000-0

Vehicle (C): 2001 Dodge  
Type: Dakota, 4x4 pickup  
Driver: 35-year-old female  
CDC: 99-0000-0

## **SITUATION**

(Slide 1) Case vehicle (A) was traveling north in the northbound lane of a straight section of a dry, asphalt, two-lane roadway, (slide 2) with a speed limit of 48 kph (30 mph). Vehicle (B) was traveling south in the southbound lane of the same roadway. Vehicle (C) was traveling north in the same northbound lane, behind case vehicle (A). Vehicle (C) struck the rear of case vehicle (A) and caused case vehicle (A) to veer sharply to the left, cross the centerline, and enter the path of vehicle (B). The driver of case vehicle (A) reportedly attempted to avoid a collision with vehicle (B) by veering to the right and braking, but case vehicle (A) struck the front of vehicle (B) with its front.

## **GENERAL VEHICLE DAMAGE AND ESTIMATED CRASH SEVERITIES**

(Slide 3) Damage to case vehicle (A) was severe. The direct-damage length for the rear impact was 151 cm and extended across the entire rear of the vehicle. The maximum crush was 91 cm and occurred 28-cm inboard from the left-front bumper corner. The direct-damage length for the frontal impact was 152 cm, and extended across the entire front of the vehicle. The maximum crush was 45 cm and occurred 56-cm inboard from the left-front bumper corner. The left wheelbase was reduced 16 cm, and the right wheelbase was reduced 8 cm.

Using the WinSMASH accident-reconstruction program and (slides 4, 5, 6, 7, 8) c-values for case vehicle (A), the following impact severities were calculated:

Vehicle	Variable	Calculated Velocity Change - kph (mph)		
		Total	Longitudinal	Latitudinal
Case Vehicle (A) rear impact	EBS	56 (35)	56 (35)	0 (0)
Case Vehicle (A) front impact	EBS	35 (22)	-33 (-21)	-12 (-8)

## **DESCRIPTION OF DAMAGE TO CASE VEHICLE (A)**

### **Exterior**

(Slides 9, 10, 11, 12, 13, 14, 15) The front bumper, both headlight assemblies, the grille, and the radiator were severely crushed from the impact with vehicle (B). (Slide 16) The hood was crushed and elevated and contacted the windshield, but did not penetrate it. (Slides 17, 18) The hood latch was damaged and released. Both hood hinges were damaged. The windshield was cracked by the stress of impact forces. The right fender was buckled and the left fender was severely buckled. Both front doors remained closed and operational. Both rear doors were jammed shut. All of the wheel struts were damaged. Both quarter-panels were severely buckled. The roof was buckled and the left upper A-pillar was deformed, as a result of the deformation of both of the C-pillars and both rear roof siderails. The back bumper, both taillight assemblies and the trunk lid were severely crushed from the rear impact by vehicle (C).

### **Interior**

(Slides 19, 20, 21, 22, 23, 24) This vehicle was equipped with both steering-wheel and passenger frontal-impact airbags, and both deployed during the frontal impact. No damage was noted to the airbag skins or (slides 25, 26, 27, 28) to the module doors/flaps. (Slide 29) No occupant contact marks were noted to the airbag module doors/flaps. (Slide 30) The upper half of the steering-wheel rim was deflected slightly forward and there was slight deformation of the steering-wheel spokes. There was minor rotation of the steering column to the right. The driver seatback recliner mechanism did not hold. (Slides 31, 32) The left rear door, the door hardware, the armrest, the left-rear glass, the left B-pillar, both rear roof siderails and the back-light header were deformed. The shelf below the back-light and the rear seatback were damaged by intrusion. (Slides 33, 34, 35, 36, 37) No contact points were noted on the left-roof siderail, the left upper A-pillar, or the left-front door interior panel. No damage was noted to the upper and mid instrument panels. The following intrusions were noted and measured.

Location	Component	Distance (cm)	Direction
left rear	seatback	40	forward
center rear	seatback	34	forward
right rear	seatback	28	forward

## OCCUPANT INJURIES AND KINEMATICS

The 5-ft, 11-in, 185-lb, 32-year-old male driver (slide 38, 39) was wearing the available three-point belt, as indicated by a webbing imprint on the plastic continuous loop of the seatbelt tongue assembly, and (slide 40) the steering-wheel airbag deployed. During the initial rear impact, he moved rearward into the seatback. (Slides 41, 42) During the frontal impact, he moved forward and slightly to the right into the shoulder belt and the airbag. He sustained a Grade-I laceration of the spleen, possibly from contact with the door. He sustained a contusion to his left hip, probably from loading by the lap belt, but possibly from contact with the door interior. (Slides 43, 44) He sustained an abrasion to the right shin, probably from contact with the knee bolster. He also sustained a fracture of the right distal 5<sup>th</sup> phalanx, possibly from hand contact with the instrument panel, although no contact point was noted that could be associated with this injury.

The following table and (slide 45) attached drawing summarize the injuries sustained by the driver.

Occupant: Driver  
Restraints: 3-point belt worn; airbag deployed

Age: 32 years  
Stature: 180 cm (5 ft, 11 in)

Gender: Male  
Mass: 84 kg (185 lb)

Injury Description	A.I.S.	Injury Source		
		Definite	Probable	Possible
Laceration, spleen, Grade-I	2			Door
Fracture, distal right 5 <sup>th</sup> phalanx	1			Instrument panel
Contusion, left hip	1		Lap belt	Door
Abrasion, right shin	1		Knee bolster	
<u>Maximum A.I.S. Level</u>	<u>2</u>			
<u>Injury Severity Score</u>	<u>6</u>			

TIME

DATE OF COLLISION

      /       /            

HOUR OF COLLISION  
(24 HOUR CLOCK)

LOCATION

STATE:                     

STATE FIPS CODE

AREA

- (1) URBAN  
(2) RURAL  
(9) UNKNOWN

ENVIRONMENTAL CONDITIONS

LIMITED-ACCESS HIGHWAY

- (0) NO  
(1) YES  
(9) UNKNOWN

ROAD, TOTAL TRAFFIC LANES  
(FOR CASE VEHICLE)

- (1) 1-LANE  
(2) 2-LANES  
(3) 3-LANES  
(4) 4 OR MORE LANES  
(5) DIVIDED, 4 OR MORE LANES  
(6) PARKING LOT/DRIVEWAY  
(7) OTHER:                       
(9) UNKNOWN

INTERSECTING RD, TOTAL LANES  
CHOOSE FROM ABOVE LIST, OR

- (8) NOT APPLICABLE

TYPE OF ROAD SURFACE

- (1) ASPHALT  
(2) CONCRETE  
(3) GRAVEL  
(4) MORE THAN ONE (CIRCLE EACH)  
(7) OTHER:                       
(9) UNKNOWN

ROAD DEFECTS

- (0) NO  
(1) YES  
(9) UNKNOWN

ENVIRONMENTAL CONDITIONS

CONSTRUCTION ZONE

- (0) NO  
(1) YES  
(9) UNKNOWN

ROAD ALIGNMENT  
VERTICAL PLANE

- (1) LEVEL  
(2) CREST OF HILL  
(3) SLOPE (2%)  
(4) BOTTOM OF HILL  
(9) UNKNOWN

ROAD ALIGNMENT  
HORIZONTAL PLANE

- (1) STRAIGHT  
(2) CURVE  
(3) T - SHAPED  
(4) Y - SHAPED  
(7) OTHER:                       
(9) UNKNOWN

SURFACE COVERING

- (10) DRY  
  
(21) WATER - DAMP  
(22) WATER - WET  
(23) WATER - PUDDLED  
(29) WATER - AMOUNT UNKNOWN  
  
(31) SNOW - LOOSE  
(32) SNOW - PACKED  
(39) SNOW - CONDITION UNKNOWN  
  
(41) ICE  
(51) SLUSH  
(61) SPILLED GRAVEL  
(71) OTHER:                       
(99) UNKNOWN

VISIBILITY LIMITATION  
(FOR CASE VEHICLE)

- (0) NONE  
(1) CLOUDY/DARK  
(2) FOG  
(3) SMOKE  
(4) WINDSHIELD CONDITION  
(5) GLARE  
(6) RAIN  
(7) OTHER:                       
(8) ICE/SNOW  
(9) UNKNOWN

VISIBILITY OBSTRUCTION  
(FOR CASE VEHICLE)

- (0) NONE  
(1) BUILDING  
(2) SIGN  
(3) VEGETATION (E.G. BUSHES, SHRUBS)  
(4) TREE  
(5) HILL OR CURVE IN ROAD  
(6) VEHICLE IN TRANSPORT  
(7) OTHER:                       
(8) PARKED VEHICLE  
(9) UNKNOWN

## ENVIRONMENTAL CONDITIONS

**SPEED LIMIT**

- |     |                 |          |
|-----|-----------------|----------|
| (0) | 5-45 km/h ..... | 5-25 mph |
| (1) | 46-55 .....     | 30       |
| (2) | 56-60 .....     | 35       |
| (3) | 61-70 .....     | 40       |
| (4) | 71-79 .....     | 45       |
| (5) | 80-85 .....     | 50       |
| (6) | 86-90 .....     | 55       |
| (7) | 91-105 .....    | 60       |
| (8) | OVER 105 .....  | 65       |
| (9) | UNKNOWN         |          |

40

## PRECIPITATION

- (0) NONE  
(1) RAIN  
(2) SNOW  
(3) HAIL  
(4) FREEZING RAIN/SLEET  
(7) OTHER: \_\_\_\_\_  
(9) UNKNOWN

0  
41

### RATE OF PRECIPITATION

- (1) LIGHT/MIST  
(2) MODERATE  
(3) HEAVY  
(8) NOT APPLICABLE  
(9) UNKNOWN

8  
—  
42

## TEMPERATURE

- (0) BELOW -15° C ..... BELOW 5° F  
(1) -15 TO -6 ..... 5 TO 22  
(2) -5 TO -1 ..... 23 TO 31  
(3) 0 TO 2 ..... 32 TO 36  
(4) 3 TO 5 ..... 37 TO 41  
(5) 6 TO 15 ..... 42 TO 59  
(6) 16 TO 25 ..... 60 TO 77  
(7) 26 TO 35 ..... 78 TO 95  
(8) OVER 35 ..... OVER 96  
(9) UNKNOWN

9  
—  
43

## CROSSWIND

- (0) NONE  
(1) LIGHT  
(2) STRONG  
(3) GUSTY & STRONG  
(9) UNKNOWN

9  
44

## LIGHT CONDITIONS

- (1) DAYLIGHT
- (2) DAWN
- (3) DUSK
- (4) DARK, LIGHTED
- (5) DARK, UNLIGHTED
- (6) DARK, UNKNOWN IF LIGHTED
- (9) UNKNOWN

1

---

45

## MECHANICAL MALFUNCTION

WAS THERE MENTION  
OF A MECHANICAL MALFUNCTION  
IN CASE VEHICLE

- (0) NO  
(1) YES  
(2) YES, DID NOT CONTRIBUTE  
TO ACCIDENT  
(9) UNKNOWN

46

**THE FOLLOWING SECTION SHOULD BE FILLED  
OUT IF A MECHANICAL MALFUNCTION IS  
RECOGNIZED OR SUSPECTED.**

**CIRCLE ITEMS INVOLVED. SUPPORT ANY  
ITEMS CIRCLED WITH COMMENTS.**

## BRAKE SYSTEM

## EXHAUST SYSTEM

STEERING SYSTEM      FUEL SYSTEM

## SUSPENSION SYSTEM VISIBILITY ITEMS

ELECTRICAL SYSTEM      TIRES

THROTTLE CONTROLS UNKNOWN

OTHER: \_\_\_\_\_

COMMENTS: \_\_\_\_\_

---

---

---

---

---

---

---

## CRASH DETAILS

## CASE VEHICLE AND OBJECT

- (0) NO  
(1) YES  
(9) UNKNOWN

①  
47

HIGHEST POLICE INJURY  
SEVERITY CODE IN CRASH  
(NOT JUST CASE VEHICLE)

- (0) O - NO INJURY  
(1) C - POSSIBLE INJURY  
(2) B - NON-INCAPACITATING INJURY  
(3) A - INCAPACITATING INJURY  
(4) K - FATAL  
(5) INJURED, SEVERITY UNKNOWN  
(6) DIED PRIOR TO ACCIDENT  
(7) NON-FATAL INJURY  
SEVERITY UNKNOWN  
(9) UNKNOWN

1  
55

## CASE VEHICLE ROLLOVER

- (0) NO ROLLOVER  
(1) YES, FIRST EVENT  
(2) YES, SUBSEQUENT EVENT  
(3) YES, SEQUENCE UNKNOWN  
(9) UNKNOWN

①  
48

## DRIVER IMPAIRMENT

DRIVER ALCOHOL INVOLVEMENT  
(CASE VEHICLE)

- (0) NONE  
(1) YES  
(9) UNKNOWN/NOT REPORTED/  
NO DRIVER

①  
56

CASE VEHICLE RAN OFF ROADWAY  
(BEFORE FIRST IMPACT)

- (0) NO  
(1) YES  
(9) UNKNOWN

①  
49

DRIVER ALCOHOL BAC  
(CASE VEHICLE)

- (80) NO TEST  
(90) CHEMICAL TESTS, NO RESULTS  
(95) AUTOPSY, NO RESULTS  
(99) UNKNOWN

80  
57 58

MOVING CASE VEHICLE AND  
CONTACTED MOVING VEHICLE

- (0) NO  
(1) YES  
(9) UNKNOWN

1  
50

WAS THERE MENTION OF DRIVER  
IMPAIRMENT FOR CASE VEHICLE?

- (0) NO  
(1) YES  
(9) UNKNOWN

①  
59

CASE VEHICLE AND  
CONTACTED STOPPED VEHICLE

- (0) NO  
(1) YES  
(9) UNKNOWN

①  
51

STOPPED CASE VEHICLE AND  
CONTACTED VEHICLE

- (0) NO  
(1) YES  
(9) UNKNOWN

①  
52

## LIST IMPAIRMENTS MENTIONED:

---

---

---

TOTAL NUMBER  
OF VEHICLES CONTACTED  
BY CASE VEHICLE IN CRASH

- (8) 8 OR MORE  
(9) UNKNOWN

2  
53

## POST - CRASH DETAIL

MANNER CASE VEHICLE  
LEFT SCENE

- (1) DRIVEN  
(2) TOWED DUE TO DAMAGE  
(3) TOWED, NOT DUE TO DAMAGE  
(4) TOWED, REASON UNKNOWN  
(9) UNKNOWN

2  
60

ANY FIRE IN THIS CRASH  
(NOT JUST CASE VEHICLE)

- (0) NO  
(1) YES  
(9) UNKNOWN

①  
54



# ACCIDENT SCHEMATIC


ACCIDENT DESCRIPTION: Case vehicle (A) was traveling north on a 2-lane roadway. Vehicle (B) was traveling south on the same roadway. Vehicle (C) was traveling north behind case vehicle (A). Vehicle (C) struck the rear of case vehicle (A) and caused case vehicle (A) to veer sharply to the left, cross the center line, and enter the path of vehicle (B). The driver of case vehicle (A) attempted to avoid a collision with vehicle (B) by veering to the right and braking, but case vehicle (A) struck the front of vehicle (B) with its front.

CASE VEHICLE (A): 1999 Volkswagen Jetta  
 OTHER VEHICLE (B): 1998 Dodge RAM 1500 4x4 pickup  
 THIRD VEHICLE (C): 2001 Dodge Dakota 4x4 pickup



NORTH

48 kph (30 mph) speed limit

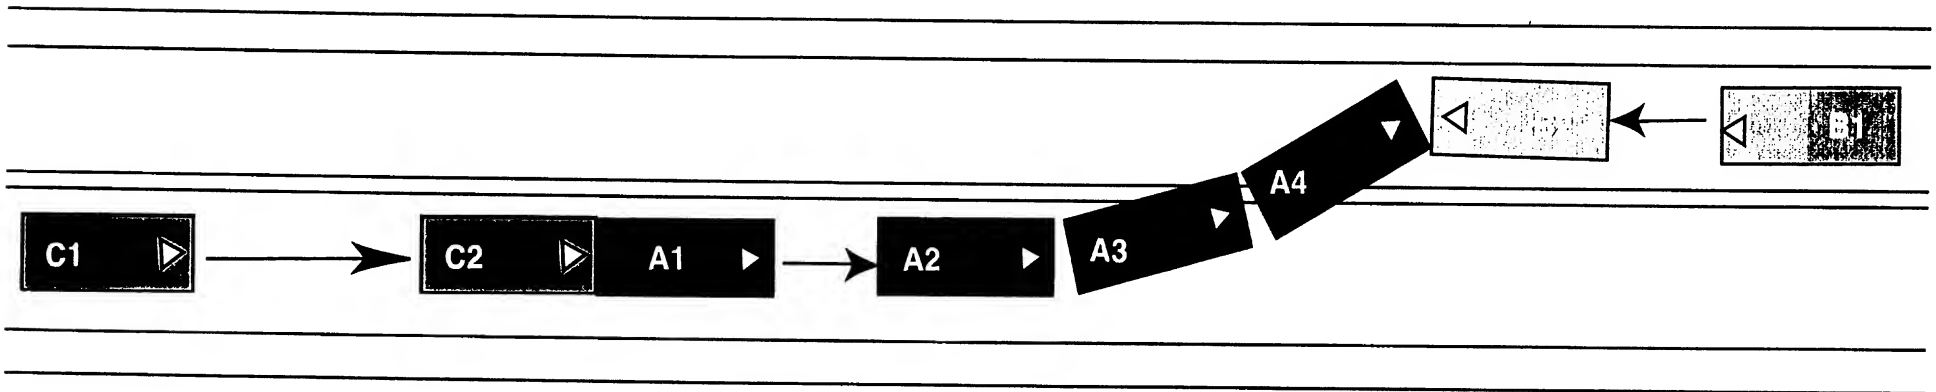

Duplicate columns 1-8  
from the previous card.

Module 0 V Format 0 4  
9 10 11 12

OTHER VEHICLE OV-1

MAKE: Dodge  
MODEL: Ram 1500 Clubcab

CARGO: unknown

VIN 1B7HF13Y4WJ [REDACTED] (VEH. B.)  
13 29

MANUFAC/BODY CODE 13212  
30 34

MAKE/MODEL CODE 3235  
38

MODEL YEAR 1998  
39 42

VEHICLE MASS (kg) 002273  
43 48

IF SEPARATE REPORT WAS MADE,  
GIVE VEHICLE NUMBER 0

NUMBER OF OCCUPANTS  
(ENTER 9'S IF UNKNOWN) 01  
51

TRAVELING SPEED (km/h) 999  
54

- (000) PARKED OR STOPPED  
(995) JUST STARTING UP  
(996) BACKING UP  
(997) SPEED NOT EXCESSIVE (BUT UNKNOWN)  
(998) SPEED EXCESSIVE (BUT UNKNOWN)  
(999) UNKNOWN

HIGHEST POLICE INJURY SEVERITY  
CODE FOR THIS VEHICLE

- (0) O - NO INJURY  
(1) C - POSSIBLE INJURY  
(2) B - NON-INCAPACITATING INJURY  
(3) A - INCAPACITATING INJURY  
(4) K - FATAL  
(5) INJURED, SEVERITY UNKNOWN  
(6) DIED PRIOR TO ACCIDENT  
(7) NON-FATAL INJURY  
SEVERITY UNKNOWN  
(8) UNOCCUPIED VEHICLE  
(NOT APPLICABLE)  
(9) UNKNOWN

0  
55

VEHICLE TYPE

PASSENGER VEHICLE

- (02) LARGE  
(03) LIMOUSINE  
(17) PICKUP CAR  
(20) UNKNOWN PASSENGER VEHICLE BODY  
(24) SUB-MINI  
(25) MINI  
(26) SUB-COMPACT  
(27) COMPACT  
(28) INTERMEDIATE  
(29) FULL

12  
56 57

MULTIPURPOSE PASSENGER VEHICLE

- (14) SMALL UTILITY (WHEELBASE LESS THAN 107",  
E.G. JEEP, BRONCO)  
(15) LARGE UTILITY (WHEELBASE MORE THAN 107",  
E.G. PANEL TRUCK, SUBURBAN)  
(16) PICKUP TRUCK WITH CANOPY/SHELL COVER  
(17) PICKUP CAR WITH CANOPY/SHELL COVER  
(21) MOTOR HOME  
(22) PICKUP TRUCK WITH SLIDE-IN CAMPER  
(23) PICKUP CAR WITH SLIDE-IN CAMPER  
(31) CHASSIS-MOUNTED CAMPER

TRUCK

- (11) VAN  
(12) PICKUP TRUCK  
(13) UNKNOWN LIGHT TRUCK  
(15) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)  
(16) PICKUP TRUCK WITH CANOPY/SHELL COVER  
(22) PICKUP TRUCK WITH SLIDE-IN CAMPER  
(30) UNKNOWN TRUCK TYPE  
(31) CHASSIS-MOUNTED CAMPER  
(33) DELIVERY VAN (WALK-IN)  
(34) STRAIGHT TRUCK  
(35) TRUCK-TRACTOR (BOBTAIL)  
(36) CHASSIS-CAB  
(37) UNKNOWN HEAVY TRUCK  
(38) TRACTOR & SEMI-TRAILER (SEMI)  
(39) TRUCK (OR SEMI) & FULL TRAILER(S)

BUS

- (40) UNKNOWN BUS TYPE  
(41) SCHOOL BUS  
(42) INTERCITY BUS (BETWEEN CITIES)  
(43) TRANSIT BUS (INTRACITY)  
(44) STREETCAR (ON TRACKS)

- (68) TRAIN (CARS)  
(69) LOCOMOTIVE (ENGINE, SWITCHER)

- (99) UNKNOWN

WHEELBASE (cm)  
(999) UNKNOWN

353  
58 59 60

Duplicate columns 1-8  
from the previous card.

Module 0 9 V 10 Format 0 2  
11 12

OTHER VEHICLE OV-2

ORIGINAL SPECIFICATIONS

Wheelbase	<u>353</u> cm	Front Overhang	<u>098</u> cm
Curb Weight	<u>2273</u> kg	Rear Overhang	<u>110</u> cm
Average Track Width	<u>172</u> cm	Undeformed End Width (UEW)	<u>110</u> cm
Overall Length	<u>559</u> cm	Engine Displacement	<u>5.2</u> L
Overall Width (OAW)	<u>202</u> cm	Engine: # of Cylinders	<u>08</u>

VEHICLE DAMAGE

Not Inspected

FRONTAL CRASH OVERLAP

Round up for .5. 98 = 98% or more  
Enter % overlap or "99" for missing or N/A.

Direct Damage Length (DDL)

Front-End Overlap (Percent) =  $\frac{DDL}{UEW}$

Vehicle Overlap (Percent) =  $\frac{DDL + 1/2 (OAW - UEW)}{OAW}$

999 cm  
99 %  
99 %

Duplicate columns 1-8  
from the previous card.

Module 0 V Format 0 4  
9 10 11 12

OTHER VEHICLE OV-1

MAKE: Dodge  
MODEL: Dakota 4x4

CARGO: Unknown

VIN 1B7GG2AN11S [REDACTED] (veh.C)  
13 29

MANUFAC/BODY CODE

13212  
30 34

MAKE/MODEL CODE

3225  
38

MODEL YEAR

2001  
39 42

VEHICLE MASS (kg)

999999  
43 48

IF SEPARATE REPORT WAS MADE,  
GIVE VEHICLE NUMBER

0

NUMBER OF OCCUPANTS  
(ENTER 9'S IF UNKNOWN)

01  
51

TRAVELING SPEED (km/h)

999  
54

(000) PARKED OR STOPPED  
(995) JUST STARTING UP  
(996) BACKING UP  
(997) SPEED NOT EXCESSIVE (BUT UNKNOWN)  
(998) SPEED EXCESSIVE (BUT UNKNOWN)  
(999) UNKNOWN

HIGHEST POLICE INJURY SEVERITY  
CODE FOR THIS VEHICLE

(0) O - NO INJURY  
(1) C - POSSIBLE INJURY  
(2) B - NON-INCAPACITATING INJURY  
(3) A - INCAPACITATING INJURY  
(4) K - FATAL  
(5) INJURED, SEVERITY UNKNOWN  
(6) DIED PRIOR TO ACCIDENT  
(7) NON-FATAL INJURY  
SEVERITY UNKNOWN  
(8) UNOCCUPIED VEHICLE  
(NOT APPLICABLE)  
(9) UNKNOWN

0  
55

#### VEHICLE TYPE

##### PASSENGER VEHICLE

- (02) LARGE
- (03) LIMOUSINE
- (17) PICKUP CAR
- (20) UNKNOWN PASSENGER VEHICLE BODY
- (24) SUB-MINI
- (25) MINI
- (26) SUB-COMPACT
- (27) COMPACT
- (28) INTERMEDIATE
- (29) FULL

##### MULTIPURPOSE PASSENGER VEHICLE

- (14) SMALL UTILITY (WHEELBASE LESS THAN 107",  
E.G. JEEP, BRONCO)
- (15) LARGE UTILITY (WHEELBASE MORE THAN 107",  
E.G. PANEL TRUCK, SUBURBAN)
- (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
- (17) PICKUP CAR WITH CANOPY/SHELL COVER
- (21) MOTOR HOME
- (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
- (23) PICKUP CAR WITH SLIDE-IN CAMPER
- (31) CHASSIS-MOUNTED CAMPER

##### TRUCK

- (11) VAN
- (12) PICKUP TRUCK
- (13) UNKNOWN LIGHT TRUCK
- (15) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)
- (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
- (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
- (30) UNKNOWN TRUCK TYPE
- (31) CHASSIS-MOUNTED CAMPER
- (33) DELIVERY VAN (WALK-IN)
- (34) STRAIGHT TRUCK
- (35) TRUCK-TRACTOR (BOBTAIL)
- (36) CHASSIS-CAB
- (37) UNKNOWN HEAVY TRUCK
- (38) TRACTOR & SEMI-TRAILER (SEMI)
- (39) TRUCK (OR SEMI) & FULL TRAILER(S)

##### BUS

- (40) UNKNOWN BUS TYPE
- (41) SCHOOL BUS
- (42) INTERCITY BUS (BETWEEN CITIES)
- (43) TRANSIT BUS (INTRACITY)
- (44) STREETCAR (ON TRACKS)

- (68) TRAIN (CARS)
- (69) LOCOMOTIVE (ENGINE, SWITCHER)

(99) UNKNOWN

WHEELBASE (cm)  
(999) UNKNOWN

12  
56 57

999  
58 59 60

Duplicate columns 1-8  
from the previous card.

Module 0 V Format 0 2  
9 10 11 12

OTHER VEHICLE OV-2

ORIGINAL SPECIFICATIONS

Wheelbase	<u>999</u> cm	Front Overhang	<u>087</u> cm
Curb Weight	<u>9999</u> kg	Rear Overhang	<u>126</u> cm
Average Track Width	<u>155</u> cm	Undeformed End Width (UEW)	<u>150</u> cm
Overall Length	<u>999</u> cm	Engine Displacement	<u>4.7</u> L
Overall Width (OAW)	<u>182</u> cm	Engine: # of Cylinders	<u>08</u>

VEHICLE DAMAGE

Not Inspected

FRONTAL CRASH OVERLAP

Round up for .5. 98 = 98% or more  
Enter % overlap or "99" for missing or N/A.

Direct Damage Length (DDL)

Front-End Overlap (Percent) =  $\frac{DDL}{UEW}$

Vehicle Overlap (Percent) =  $\frac{DDL + 1/2 (OAW - UEW)}{OAW}$

<u>999</u> cm
<u>99</u> %
<u>99</u> %

MAKE: Volkswagen  
MODEL: Tetta GLS

CARGO: Unknown

VIN 3<sub>13</sub> V W S A 2 9 M 6 X M [REDACTED] [REDACTED]

MANUFAC/BODY CODE 181 AV  
30 34

MAKE/MODEL CODE 0832

MODEL YEAR 1 9 9 9

VEHICLE MASS (kg) 0 0 1 2 7 9  
43 48

ODOMETER (km) 888888  
(ENTER 9'S IF UNKNOWN)  
(ENTER 8'S IF ELECTRONIC) 49 54

NUMBER OF OCCUPANTS  
(ENTER 9'S IF UNKNOWN) 0 1 56

TRAVELING SPEED (km/h) \_\_\_\_\_

- (000) PARKED OR STOPPED  
(995) JUST STARTING UP  
(996) BACKING UP  
(997) SPEED NOT EXCESSIVE (BUT UNKNOWN)  
(998) SPEED EXCESSIVE (BUT UNKNOWN)  
(999) UNKNOWN

**STOLEN VEHICLE**

- (0) NO  
(1) YES  
(8) NOT COLLECTED  
(9) UNKNOWN

$$\frac{8}{2}$$

## BODY STRUCTURE

- (1) BODY & FRAME  
(2) UNITIZED  
(3) INTEGRAL-STUB FRAME  
(4) BODY & PLATFORM FRAME  
(E.G. VW BUG)  
(5) PARTIALLY UNITIZED  
(7) OTHER: \_\_\_\_\_  
(9) UNKNOWN

2

## TRANSMISSION

- (0) NONE  
(1) AUTOMATIC  
(2) MANUAL  
(9) UNKNOWN

---

64

## VEHICLE TYPE

**PASSENGER VEHICLE**

- (11) 2-DOOR HARDTOP (NO UPPER B-PILLAR)  
(12) 2-DOOR SEDAN OR COUPE  
(ANY UPPER B-PILLAR)  
(13) 4-DOOR HARDTOP  
(14) 4-DOOR SEDAN  
(15) STATION WAGON  
(16) CONVERTIBLE  
(18) OTHER PASS. VEH. : \_\_\_\_\_  
(19) PASSENGER VEHICLE, TYPE UNKNOWN

$$\begin{array}{r} 14 \\ \hline 60 \end{array} \quad \begin{array}{r} 14 \\ \hline 61 \end{array}$$

**MULTIPURPOSE PASSENGER VEHICLE**

- (21) SMALL UTILITY (E.G. JEEP, SCOUT, BRONCO)  
(22) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)  
(23) VAN, SIZE UNKNOWN  
(24) VAN, SMALL (MINI)  
(25) VAN, LARGE  
(29) MPV, TYPE UNKNOWN  
(30) MOTOR HOME

## TRUCK

- (31) PICKUP TRUCK, UNKNOWN  
(32) PICKUP TRUCK, SMALL (DOWNSIZED)  
(33) PICKUP TRUCK, LARGE  
  
(99) UNKNOWN

### LOCATION OF TRANSMISSION SELECTOR LEVER

- (1) FLOOR  
(2) CONSOLE  
(3) COLUMN  
(7) OTHER: \_\_\_\_\_  
(9) UNKNOWN

2

## STEERING

- (1) POWER  
(2) MANUAL  
(9) UNKNOWN

---

## BRAKES

- (1) POWER  
(2) MANUAL  
(9) UNKNOWN

1.

TYPE OF BRAKES

- (1) DRUM, ALL WHEELS
- (2) DISC, FRONT WHEELS
- (3) DISC, ALL WHEELS
- (9) UNKNOWN

3  
68

WHEELBASE (cm)  
(999) Unknown

251  
76 77 78

BRAKE ANTI-LOCK DEVICE

- (0) NONE INSTALLED
- (1) TWO-WHEEL
- (2) FOUR-WHEEL
- (7) EQUIPPED, UNKNOWN WHEELS
- (9) UNKNOWN

2  
69

PLASTIC ANTI-LACERATIVE  
INNER LAYER GLASS EQUIPPED

- (0) NONE
- (1) WINDSHIELD
- (2) WINDSHIELD AND SIDE
- (7) OTHER
- (9) UNKNOWN

0  
79

AIR CONDITIONING IN VEHICLE

- (0) NO
- (1) YES
- (8) NOT COLLECTED
- (9) UNKNOWN

8  
70

TYPE OF DRIVE

- (1) REAR WHEEL
- (2) FRONT WHEEL
- (3) FOUR WHEEL
- (4) ALL WHEEL DRIVE
- (9) UNKNOWN

2  
71

FIELD INVESTIGATOR INSTRUCTIONS:

1. INDICATE CRUSHED AREAS BY OUT-LINING NEW PERIMETER OF VEHICLE AND SHADING THE DAMAGED AREAS ON THE LARGE SKETCH ON PAGE VD-3. USE AS MANY SKETCHES AS NECESSARY TO COMPLETELY DESCRIBE THE DAMAGE.
2. ENTER THE DIMENSIONS ON THE SKETCH(ES) MEASURED TO THE POINT OF MAXIMUM PENETRATION BY THE OBJECT(S) CONTACTED. USE THE EXAMPLES BELOW AS A GUIDE.
3. ENTER THE THREE DIMENSIONS TO THE CENTER OF THE WHEELS (WHEELBASE, FRONT AND REAR OVERHANGS) ON BOTH SIDES OF THE CAR.
4. ADD OTHER DIMENSIONS AS NECESSARY TO COMPLETELY DESCRIBE THE DAMAGE.

EXAMPLES:

DUAL REAR WHEELS

- (0) NO
- (1) YES
- (9) UNKNOWN

0  
72

ORIGINAL TYPE  
OF RESTRAINT SYSTEM

- (1) ACTIVE BELT
- (2) PASSIVE BELT
- (3) AIRBAG
- (4) KNEE BOLSTERS
- (7) OTHER: \_\_\_\_\_
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

3  
73

EQUIPPED WITH ROLL BAR

- (0) NO
- (1) YES
- (9) UNKNOWN


0  
74

TYPE OF ROOF


- (0) NONE
- (1) SOLID
- (2) T-TOP CLOSED
- (3) T-TOP OPEN
- (4) SUN ROOF CLOSED
- (5) SUN ROOF OPEN
- (6) CONVERTIBLE CLOSED
- (7) CONVERTIBLE OPEN
- (8) OTHER: \_\_\_\_\_
- (9) UNKNOWN

1  
75

FRONT OR REAR

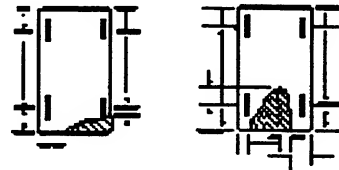

SIDE

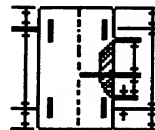

ROOF (REFERENCE TO  
TOP OF DOOR SILL  
OR WINDOW SILL)



Duplicate columns 1-8  
from the previous card.


Module V D Format 0 2  
9 10 11 12

# VEHICLE DESCRIPTION VD-3

## ORIGINAL SPECIFICATIONS

Wheelbase	<u>251</u> cm	Front Overhang	<u>088</u> cm
Curb Weight	<u>1279</u> kg	Rear Overhang	<u>078</u> cm
Average Track Width	<u>150</u> cm	Undeformed End Width (UEW)	<u>150</u> cm
Overall Length	<u>415</u> cm	Engine Displacement	<u>2.0</u> L
Overall Width (OAW)	<u>174</u> cm	Engine: # of Cylinders	<u>04</u>

## MEASUREMENTS IN CENTIMETERS

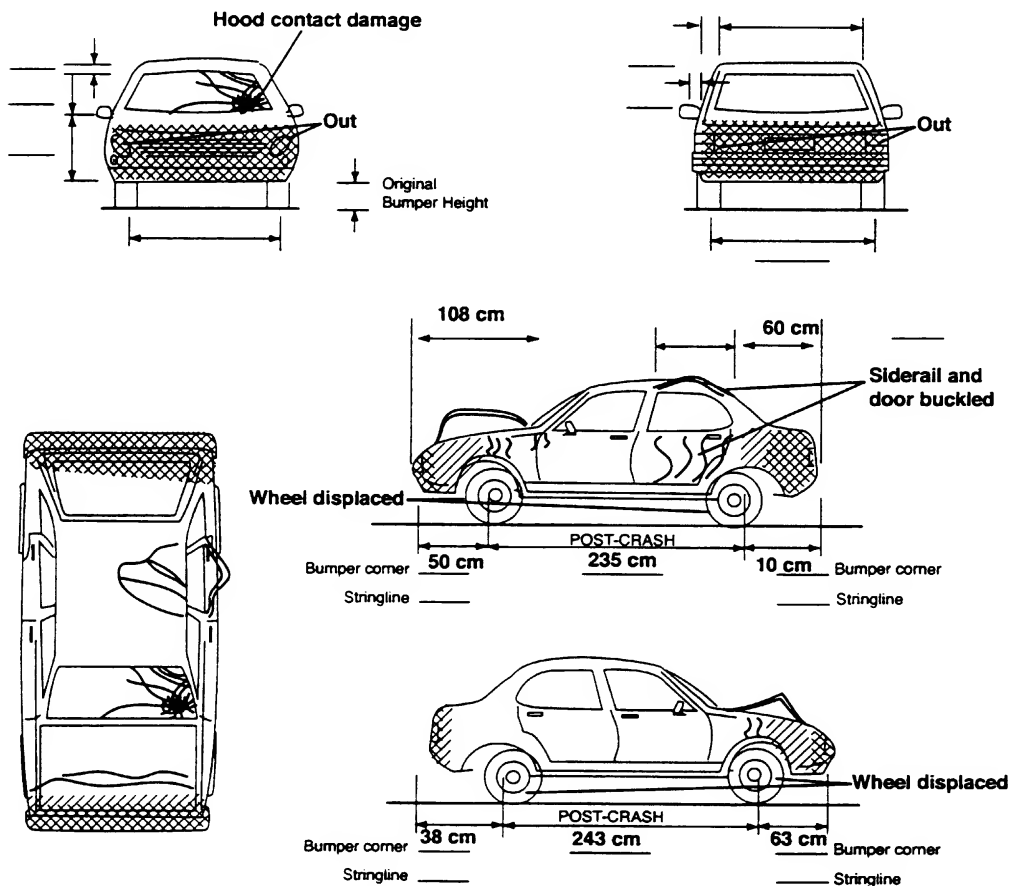

## FRONTAL CRASH OVERLAP

Round up for .5. 98 = 98% or more  
Enter % overlap or "99" for missing or N/A.

Direct Damage Length (DDL)

Front-End Overlap (Percent) =  $\frac{DDL}{UEW}$

Vehicle Overlap (Percent) =  $\frac{DDL + 1/2 (OAW - UEW)}{OAW}$

151 cm  
35 37  
98 %  
38 39  
98 %  
40 41



Duplicate columns 1-8  
from the previous card.

Module D A Format 0 2  
9 10 11 12

DAMAGE DA-1

PRIMARY	CASE VEHICLE PRIMARY CDC	CONTACTED VEHICLE ASSOCIATED CDC
EVENT NUMBER	<u>1</u> 13	
IMPACT SPEED (km/h)	<u>999</u> 14 15 16	<u>999</u> 35 36 37
ESTIMATED BY	<u>1</u> 17	<u>1</u> 38
CRUSH (cm)	<u>091</u> 18 19 20	<u>999</u> 39 40 41
CDC #1	<u>06.BDEW.7</u> 21 27	<u>99.00000.0</u> 42 48
CDC #2	<u>98.00000.0</u> 28 34	<u>98.00000.0</u> 49 55

Duplicate columns 1-8  
from the previous card.

Module D A Format 0 3  
9 10 11 12

SECONDARY	CASE VEHICLE SECONDARY CDC	CONTACTED VEHICLE ASSOCIATED CDC
EVENT NUMBER	<u>2</u> 13	
IMPACT SPEED (km/h)	<u>999</u> 14 15 16	<u>999</u> 35 36 37
ESTIMATED BY	<u>1</u> 17	<u>1</u> 38
CRUSH (cm)	<u>045</u> 18 19 20	<u>999</u> 39 40 41
CDC #1	<u>01.FDEW.3</u> 21 27	<u>99.00000.0</u> 42 48
CDC #2	<u>98.00000.0</u> 28 34	<u>98.00000.0</u> 49 55

## CODES

### EVENT NUMBER

- (8) NOT APPLICABLE  
(9) UNKNOWN

### IMPACT SPEED

- (998) NOT APPLICABLE  
(999) UNKNOWN

### IMPACT SPEED ESTIMATOR

- (1) INVESTIGATOR  
(2) DRIVER  
(3) POLICE  
(4) "CRASH" PROGRAM  
(5) OTHER COMPUTER PROGRAM  
SPECIFY: \_\_\_\_\_  
(7) OTHER: \_\_\_\_\_  
(8) NOT APPLICABLE  
(NO VEHICLE/NO IMPACT)

### CRUSH

- (998) NOT APPLICABLE  
(NO VEHICLE/DAMAGE)  
(999) UNKNOWN

### CDC

- (9800000) NOT APPLICABLE  
(9900000) UNKNOWN

### MAXIMUM SHEET METAL CRUSH

(cm) (999) UNKNOWN

FRONT 045  
13 15

REAR 091  
19 21

ROOF 000  
25 27

RIGHT SIDE 000  
16 18

LEFT SIDE 000  
22 24

OTHER 000  
28 30

### CHRONOLOGICAL SEQUENCE OF DAMAGE/INJURY PRODUCING CRASH EVENTS FOR CASE VEHICLE

NOTE: IF CHRONOLOGICAL ORDER  
IS UNKNOWN, EVENT  
ORDER IS OPTIONAL.

DO YOU KNOW THIS TABLE  
TO BE IN CHRONOLOGICAL ORDER?

1  
31

(0) NO  
(1) YES

EVENT NUMBER	IMPACT LOCATION (1) ON ROADWAY (2) SHOULDER/MEDIAN/GORE (3) ON ROADSIDE (4) OUTSIDE ROADSIDE RIGHT-OF-WAY (5) OTHER (6) OFF ROADWAY, LOC. UNK. (9) UNKNOWN	IMPACT CONFIGURATION FOR CODES, SEE TABLE ON PAGE DA-3.	OBJECT/VEHICLE CONTACTED FOR CODES, SEE TABLE ON PAGE DA-4.
# 1	<u>1</u> 32	<u>31</u> 34	<u>12</u> 36
#2	<u>1</u> 37	<u>11</u> 39	<u>12</u> 41
#3	<u>  </u> 42	<u>  </u> 44	<u>  </u> 46
#4	<u>  </u> 47	<u>  </u> 49	<u>  </u> 51
#5	<u>  </u> 52	<u>  </u> 54	<u>  </u> 56
#6	<u>  </u> 57	<u>  </u> 59	<u>  </u> 61
#7	<u>  </u> 62	<u>  </u> 64	<u>  </u> 66

CODES FOR  
IMPACT CONFIGURATIONFRONT OF CASE VEHICLE

- (11) AND FRONT OF CONTACTED VEHICLE
- (13) AND SIDE OF CONTACTED VEHICLE
- (14) AND REAR OF CONTACTED VEHICLE
- (16) ENDSWIPED BY CONTACTED VEHICLE
- (17) AND OBJECT
- (19) AND UNKNOWN OTHER VEHICLE CONFIGURATION

LEFT SIDE OF CASE VEHICLE

- (21) AND FRONT OF CONTACTED VEHICLE (TYPE T)
- (22) AND FRONT OF CONTACTED VEHICLE (TYPE L)
- (23) AND SIDE OF CONTACTED VEHICLE (NOT SIDESWIPE)
- (24) AND REAR OF CONTACTED VEHICLE (TYPE T)
- (25) AND REAR OF CONTACTED VEHICLE (TYPE L)
- (26) SIDESWIPED BY CONTACTED VEHICLE
- (27) AND OBJECT
- (29) AND UNKNOWN OTHER VEHICLE CONFIGURATION

REAR OF CASE VEHICLE

- (31) AND FRONT OF CONTACTED VEHICLE
- (33) AND SIDE OF CONTACTED VEHICLE
- (34) AND REAR OF CONTACTED VEHICLE
- (36) ENDSWIPED BY CONTACTED VEHICLE
- (37) AND OBJECT
- (39) AND UNKNOWN OTHER VEHICLE CONFIGURATION

RIGHT SIDE OF CASE VEHICLE

- (41) AND FRONT OF CONTACTED VEHICLE (TYPE T)
- (42) AND FRONT OF CONTACTED VEHICLE (TYPE L)
- (43) AND SIDE OF CONTACTED VEHICLE (NOT SIDESWIPE)
- (44) AND REAR OF CONTACTED VEHICLE (TYPE T)
- (45) AND REAR OF CONTACTED VEHICLE (TYPE L)
- (46) SIDESWIPED BY CONTACTED VEHICLE
- (47) AND OBJECT
- (49) AND UNKNOWN OTHER VEHICLE CONFIGURATION

## OTHER

- (57) VEHICLE TO OBJECT
- (58) VEHICLE TO VEHICLE
- (59) VEHICLE TO VEHICLE, CONFIGURATION UNKNOWN

## ROLLOVER

- (61) LESS THAN 360°
- (62) 360° OR MORE
- (69) DETAILS UNKNOWN

## UNKNOWN

- (99) IMPACT TYPE UNKNOWN

## CODES FOR VEHICLE/OBJECT CONTACTED

## VEHICLE/OBJECT GROUPS

- (00) NO OBJECT
- (01) - (39) PASSENGER VEHICLE & TRUCK
- (40) - (69) OTHER VEHICLE
- (70) - (76) PEDESTRIAN & ON-ROADWAY OBJECT
- (77) - (97) OFF-ROADWAY OBJECT
- (98) OTHER (DESCRIBE)
- (99) UNKNOWN

## PASSENGER VEHICLE

- (02) LARGE
- (03) LIMOUSINE
- (17) PICKUP
- (20) UNKNOWN PASSENGER VEHICLE BODY
- (24) SUB-MINI
- (25) MINI
- (26) SUB-COMPACT
- (27) COMPACT
- (28) INTERMEDIATE
- (29) FULL

SIZEWHEELBASE

SUB-MINI	< 2286 mm ( < 90")
MINI	2286 - 2412 mm (90" - 94.9")
SUB-COMPACT	2413 - 2539 mm (95" - 99.9")
COMPACT	2540 - 2666 mm (100" - 104.9")
INTERMEDIATE	2667 - 2793 mm (105" - 109.9")
FULL	2794 - 2920 mm (110" - 114.9")
LARGE	2921 - 3174 mm (115" - 124.9")
LIMOUSINE	> 3175 mm ( > 125")

## MULTIPURPOSE PASSENGER VEHICLE

- (11) SMALL VAN (MINI)
- (12) PICKUP
- (14) SMALL UTILITY (WHEELBASE LESS THAN 107",  
E.G. JEEP, BRONCO)
- (15) LARGE UTILITY (WHEELBASE MORE THAN 107",  
E.G. PANEL TRUCK, SUBURBAN)
- (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
- (17) PICKUP CAR WITH CANOPY/SHELL COVER
- (21) MOTOR HOME
- (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
- (23) PICKUP CAR WITH SLIDE-IN CAMPER
- (31) CHASSIS-MOUNTED CAMPER

## TRUCK

- (11) SMALL VAN (E.G. ECONOLINE)
- (12) PICKUP TRUCK
- (13) UNKNOWN LIGHT TRUCK
- (15) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)
- (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
- (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
- (30) UNKNOWN TRUCK TYPE
- (31) CHASSIS-MOUNTED CAMPER
- (33) DELIVERY VAN (WALK-IN)
- (34) STRAIGHT TRUCK
- (35) TRUCK-TRACTOR (BOBTAIL)
- (36) CHASSIS-CAB
- (37) UNKNOWN HEAVY TRUCK
- (38) TRACTOR & SEMI-TRAILER (SEMI)
- (39) TRUCK (OR SEMI) & FULL TRAILER(S)

## BUS

- (40) UNKNOWN BUS TYPE
- (41) SCHOOL BUS
- (42) INTERCITY BUS (BETWEEN CITIES)
- (43) TRANSIT BUS (INTRACITY)
- (44) STREETCAR (ON TRACKS)

## MOTORCYCLE

- (50) UNKNOWN MOTORCYCLE TYPE
- (51) 1 - 75 cc
- (52) 76 - 125 cc
- (53) 126 - 250 cc
- (54) 251 - 500 cc
- (55) 501 - 750 cc
- (56) 751 cc +
- (57) 3-WHEELS (OR WITH SIDECAR)

## SPECIAL PURPOSE VEHICLE

- (60) UNKNOWN/OTHER SPECIAL VEHICLE (DESCRIBE)
- (61) SNOWMOBILE
- (62) ATV (ALL TERRAIN VEHICLE)
- (63) AMPHIBIOUS VEHICLE
- (64) FARM VEHICLE
- (65) CONSTRUCTION VEHICLE
- (66) TRAILER, PRIVATE (CAMPER)
- (67) TRAILER, COMMERCIAL (CARGO)
- (68) TRAIN (CARS)
- (69) LOCOMOTIVE (ENGINE, SWITCHER)

## OBJECT

- (70) PEDESTRIAN
- (71) BICYCLIST, OTHER PEDALCYCLIST
- (72) PEDESTRIAN CONVEYANCE (E.G. PERSON RIDING  
ANIMAL, CART)
- (73) LARGE ANIMAL
- (74) FALLEN OBJECT (E.G. OBJECT DISLODGED FROM  
OTHER VEHICLE, FALLEN TREE, ROCKS)
- (75) ROCKS
- (76) CONSTRUCTION EQUIPMENT (EXCLUDING (65))
- (77) SIGN POST, UTILITY POLE, TREE
- (78) DITCH
- (79) EMBANKMENT, SNOWBANK, RR TRACKS RR X
- (80) GROUND (ROLLOVER ONLY)
- (81) CURB (DAMAGE PRODUCING IMPACTS ONLY)
- (82) CULVERT
- (83) FENCE
- (84) HYDRANT, SHORT POST, STUMP
- (85) SMALL POST/TREE, RURAL MAIL BOX, MILE  
MARKER, DELINEATOR
- (86) BUILDING
- (87) PIER, PILLAR, BRIDGE SUPPORT
- (88) ABUTMENT, RETAINING WALL
- (89) BRIDGE RAIL
- (90) GUARD RAIL, LEADING SECTION
- (91) GUARD RAIL, MIDDLE OR UNKNOWN
- (92) GUARD RAIL, TRAILING SECTION
- (93) GUARD POST (TIMBER, METAL, CONCRETE)
- (94) CABLE, FENCE BARRIER
- (95) CONCRETE BARRIER (MEDIAN)
- (96) IMPACT ATTENUATOR
- (97) BREAKAWAY FEATURES



Duplicate columns 1-8  
from the previous card.

Module C R Format 0 1  
9 10 11 12

# CRASH RECONSTRUCTION CR-1

for  $\Delta V$

	CASE VEHICLE PRIMARY IMPACT			CASE VEHICLE SECONDARY IMPACT		
	CASE VEHICLE	CONTACTED VEHICLE		CASE VEHICLE	CONTACTED VEHICLE	
EVENT NUMBER	<u>1</u> 13			<u>2</u> 47		
$\Delta V$ (km/h) TOTAL	<u>999</u> 14 15 16	<u>999</u> 32 33 34		<u>999</u> 48 49 50	<u>999</u> 66 67 68	
LONGITUDINAL*	<u>9999</u> 17 20	<u>9999</u> 35 38		<u>9999</u> 51 54	<u>9999</u> 69 72	
LATERAL*	<u>9999</u> 21 24	<u>9999</u> 39 42		<u>9999</u> 55 58	<u>9999</u> 73 76	
* NOTE: THESE $\Delta V$ COMPONENTS MUST INCLUDE SIGN.						
EXAMPLES: 10 km/h = $\pm 010$ -7 km/h = $-007$						
ENERGY DISSIPATED BY CRUSH (kj)	<u>9999</u> 25 28	<u>9999</u> 43 46		<u>9999</u> 59 62	<u>9999</u> 77 80	
RECONSTRUCTION						
(01) RECONSTRUCTED, UNKNOWN CONFIDENCE LEVEL	<u>12</u> 29 30			<u>12</u> 63 64		
(21) RECONSTRUCTED, LOW CONFIDENCE LEVEL						
(22) RECONSTRUCTED, MODERATE CONFIDENCE LEVEL						
(23) RECONSTRUCTED, HIGH CONFIDENCE LEVEL						
NOT RECONSTRUCTED BECAUSE						
(02) INSUFFICIENT DATA						
(03) EXCESSIVE UNDERRIDE/ OVERRIDE						
(04) ROLLOVER						
(05) VAULTING						
(06) OTHER TRAVEL IN MORE THAN ONE PLANE						
(07) NON-HORIZONTAL FORCE						
(08) SIDESWIPE-TYPE DAMAGE						
(09) YIELDING OBJECT						
(10) OTHER: _____						
(11) AT LEAST ONE VEHICLE BEYOND SCOPE						
(12) OTHER VEHICLE NOT INSPECTED						
MODE						
(1) CDC ONLY						
(2) CDC & DETAILED DAMAGE	<u>5</u> 31			<u>5</u> 65		
(3) TRAJECTORY & CDC						
(4) TRAJECTORY & CDC & DETAILED DAMAGE						
(5) NOT RECONSTRUCTED						
COMPUTER PROGRAM SPECIFY: _____						

Duplicate columns 1-8  
from the previous card.

Module C R Format 0 2  
9 10 11 12

# CRASH RECONSTRUCTION CR-2

for EBS

	CASE VEHICLE PRIMARY IMPACT		CASE VEHICLE SECONDARY IMPACT	
	CASE VEHICLE	CONTACTED VEHICLE	CASE VEHICLE	CONTACTED VEHICLE
EVENT NUMBER	<u>1</u> 13		<u>2</u> 47	
EBS (km/h) TOTAL	<u>056</u> 14 15 16	<u>999</u> 32 33 34	<u>035</u> 48 49 50	<u>999</u> 66 67 68
LONGITUDINAL*	<u>+056</u> 17 20	<u>9999</u> 35 38	<u>-033</u> 51 54	<u>999</u> 69 72
LATERAL*	<u>+000</u> 21 24	<u>9999</u> 39 42	<u>-012</u> 55 58	<u>9999</u> 73 76
*NOTE: THESE EBS COMPONENTS MUST INCLUDE SIGN.				
EXAMPLES: 10 km/h = ± 0 1 0 -7 km/h = - 0 0 7				
ENERGY DISSIPATED BY CRUSH (kj)	<u>0165</u> 25 28	<u>9999</u> 43 46	<u>0083</u> 59 62	<u>9999</u> 77 80
RECONSTRUCTION	<u>164657</u>		<u>82707</u>	
(01) RECONSTRUCTED, UNKNOWN CONFIDENCE LEVEL	<u>21</u> 29 30		<u>21</u> 63 64	
(21) RECONSTRUCTED, LOW CONFIDENCE LEVEL				
(22) RECONSTRUCTED, MODERATE CONFIDENCE LEVEL				
(23) RECONSTRUCTED, HIGH CONFIDENCE LEVEL				
NOT RECONSTRUCTED BECAUSE				
(02) INSUFFICIENT DATA				
(03) EXCESSIVE UNDERRIDE/ OVERRIDE				
(04) ROLLOVER				
(05) VAULTING				
(06) OTHER TRAVEL IN MORE THAN ONE PLANE				
(07) NON-HORIZONTAL FORCE				
(08) SIDESWIPE-TYPE DAMAGE				
(09) YIELDING OBJECT				
(10) OTHER: _____				
(11) AT LEAST ONE VEHICLE BEYOND SCOPE				
(12) OTHER VEHICLE NOT INSPECTED				
MODE				
(1) CDC ONLY				
(2) CDC & DETAILED DAMAGE	<u>2</u> 31		<u>2</u> 65	
(3) TRAJECTORY & CDC				
(4) TRAJECTORY & CDC & DETAILED DAMAGE				
(5) NOT RECONSTRUCTED				
COMPUTER PROGRAM SPECIFY: <u>WINSMASH</u>				

Duplicate columns 1-8  
from the previous card.

Module C R Format 0 3  
9 10 11 12

# CRASH RECONSTRUCTION CR-3

## NOTES:

1. ENTER CRASH RECONSTRUCTION DAMAGE MEASUREMENTS IN CENTIMETERS.
2. MEASURE  $C_1$  TO  $C_6$  FROM DRIVER TO PASSENGER SIDE IN FRONT OR REAR IMPACTS, REAR TO FRONT IN SIDE IMPACTS.
3.  $D$  IS POSITIVE IF MEASURED TO A POINT FORWARD OF OR TO THE RIGHT OF THE CG.
4. USE THE CENTER OF THE WHEELBASE AS THE CG.

CASE VEHICLE



LOCATOR

Locate the end of the damage with respect to the vehicle longitudinal center line, or an undamaged axle for side impacts.

Specific Impact No.	Location of Direct Damage	Location of Field L
1	Begin(R) rear bumper corner	B.C. to B.C.
2	Begin(R) front bumper corner	B.C. to B.C.

## PLANE:

- (1) Bumper
- (2) Above Bumper
- (3) Sill
- (4) Above Sill
- (5) Other \_\_\_\_\_
- (9) Unknown

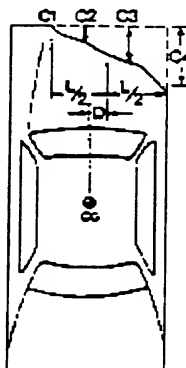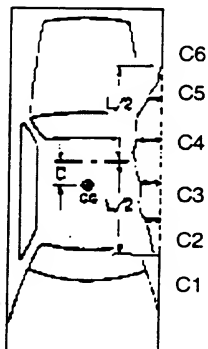

DL 150

UDL 0

## CRUSH PROFILE IN CENTIMETERS

NOTE: Each line in the table below is a separate record (card).

Duplicate columns 1 - 12 for each completed line.

Specific Impact Number	Plane of Impact C-Measur.	Direct Damage		Field L	C <sub>1</sub>	C <sub>2</sub>	C <sub>3</sub>	C <sub>4</sub>	C <sub>5</sub>	C <sub>6</sub>	±D
		Length (DDL)	Max Crush								
1	Bumper	151	C2	139	90	92	75	73	59	55	0
	- Freespace				-8	-1	0	0	-1	-8	
1	1	151	091	139	082	091	075	073	058	047	+000
13	14	15 16 17	18 19 20	21 22 23	24 25 26	27 28 29	30 31 32	33 34 35	36 37 38	39 40 41	42 43 44 45
2	Bumper	152	C3	142	51	40	46	30	21	25	+000
	- Freespace				-12	-2	1	1	-2	-12	
2	1	152	045	142	39	38	45	29	19	13	+000




- NOTES:
1. ENTER CRASH RECONSTRUCTION DAMAGE MEASUREMENTS IN CENTIMETERS.
  2. MEASURE  $C_1$  TO  $C_6$  FROM DRIVER TO PASSENGER SIDE IN FRONT OR REAR IMPACTS, REAR TO FRONT IN SIDE IMPACTS.
  3. D IS POSITIVE IF MEASURED TO A POINT FORWARD OF OR TO THE RIGHT OF THE CG.
  4. USE THE CENTER OF THE WHEELBASE AS THE CG.

# OTHER VEHICLE LOCATOR

Locate the end of the damage with respect to the vehicle longitudinal center line, or an undamaged axle for side impacts.

Specific Impact No.	Location of Direct Damage	Location of Field L

Not Inspected

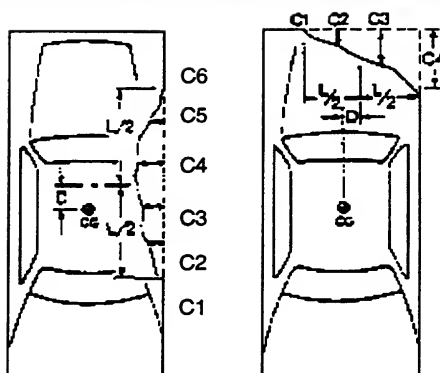

DL

UDL

PLANE:

- (1) Bumper  
(2) Above Bumper  
(3) Sill  
(4) Above Sill  
(5) Other \_\_\_\_\_  
(9) Unknown

**CRUSH PROFILE IN CENTIMETERS**

**NOTE:** Each line in the table below is a separate record (card).

Duplicate columns 1 - 12 for each completed line.

[illegible]

Duplicate columns 1-8  
from the previous card.

Module W T Format 0 1  
9 10 11 12

# WHEELS AND TIRES

WT-1

## WHEELS--DAMAGED

- (0) NO  
(1) YES  
(9) UNKNOWN

LF

0  
13

RF

0

RR

0

LR

0  
16

SIZE (NOT DOT CODE. IF UNKNOWN, USE 9'S)

LF

19565R15  
25

RF

19565R15  
35

RR

19565R15  
45

LR

19565R15  
55

## TIRE TREAD TYPE

- (1) REGULAR  
(2) SNOW  
(3) SLICKS  
(4) ALL WEATHER (MS)  
(7) OTHER: \_\_\_\_\_  
(9) UNKNOWN

LF

4  
17

RF

4

RR

4

LR

4  
20

## CARCASS CONSTRUCTION

- (1) BIAS  
(2) BELTED BIAS  
(3) RADIAL  
(4) ELLIPTICAL  
(5) HI PRESSURE SPARE  
(6) SPACE SAVER SPARE  
(7) OTHER: \_\_\_\_\_  
(9) UNKNOWN

LF

3  
21

RF

3

RR

3

LR

3  
24

IF VEHICLE IS EQUIPPED WITH DUAL  
WHEELS, COMPLETE FOR OUTER WHEELS  
AND MAKE NOTES ON INNER WHEELS.

NOTES: \_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

Duplicate columns 1-8  
from the previous card.

Module F T Format 0 1  
9 10 11 12

## FUEL AND FUEL TANKS FT-1

### TYPE OF PROPULSIVE FUEL

- (1) GASOLINE
- (2) DIESEL OIL
- (3) LPG
- (4) ELECTRIC
- (7) OTHER: \_\_\_\_\_
- (9) UNKNOWN

1  
13

### AUXILIARY TANK TYPE

- (1) OEM TANK
- (2) AFTER MARKET TANK
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

8  
21

### MAIN TANK LOCATION

322  
14 16

### AUXILIARY TANK LOCATION

888  
22 24

### MAIN FILLER CAP LOCATION

133  
17 19

### AUXILIARY FILLER CAP LOCATION

888  
25 27

### MAIN TANK MATERIAL

3  
20

### AUXILIARY TANK MATERIAL

8  
28

## TANK AND FILLER CAP LOCATION CODES

### FIRST DIGIT (LONGITUDINAL)

- (1) BEHIND KICK-UP
- (2) IN KICK-UP
- (3) BETWEEN KICK-UP & COWL
- (4) FORWARD OF COWL
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

### SECOND DIGIT (LATERAL)

- (1) LEFT OF FRAME
- (2) WITHIN FRAME OR CENTERED
- (3) RIGHT OF FRAME
- (4) DUAL, RIGHT & LEFT TANKS
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

### THIRD DIGIT (VERTICAL)

- (1) BELOW FRAME
- (2) WITHIN FRAME OR CENTERED
- (3) ABOVE FRAME
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

## TANK MATERIAL CODES

- (1) STEEL
- (2) ALUMINUM
- (3) PLASTIC
- (7) OTHER
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

Duplicate columns 1-8  
from the previous card.

Module F L Format 0 1  
9 10 11 12

FUEL LEAKAGE FL-1

# DID FUEL LEAKAGE RESULT FROM A CRASH EVENT

(0) NO KNOWN LEAKAGE SKIP PAGE.

(1) YES COMPLETE PAGE.

①  
13

LEAK NUMBER	I LEAKING COMPONENT	II COMPONENT SOURCE	III TYPE OF DAMAGE	IV SEVERITY OF DAMAGE	V LOCATION OF LEAK	EVENT NUMBER
#1	_____ 14 15	_____	_____	_____	_____ _____ _____	_____ 21
#2	_____ 22 23	_____	_____	_____	_____ _____ _____	_____ 29
#3	_____ 30 31	_____	_____	_____	_____ _____ _____	_____ 37
#4	_____ 38 39	_____	_____	_____	_____ _____ _____	_____ 45
#5	_____ 46 47	_____	_____	_____	_____ _____ _____	_____ 53

## I LEAKING COMPONENT

### TANK AREA

- (11) MAIN FUEL TANK (INCLUDING VAPOR RECOVERY DOME)
- (12) AUXILIARY FUEL TANK
- (13) MAIN TANK FILLER TUBE
- (14) MAIN TANK CAP (GAS CAP)
- (15) AUXILIARY TANK FILLER TUBE
- (16) AUXILIARY TANK CAP (GAS CAP)
- (19) TANK AREA, DETAILS UNKNOWN

### DELIVERY SYSTEM

- (21) FUEL FEED LINE (MAIN TANK TO FUEL PUMP)
- (22) FUEL FEED LINE (AUXILIARY TANK TO FUEL PUMP)
- (23) FUEL RETURN LINE (FUEL PUMP TO TANK)
- (24) INLINE FUEL FILTER
- (25) FUEL LINE (PUMP TO CARBURETOR OR INJECTOR PUMP)
- (26) CARBURETOR TO INJECTOR PUMP
- (27) FUEL PUMP
- (29) DELIVERY SYSTEM, DETAILS UNKNOWN

### EVAPORATIVE EMISSION CONTROL SYSTEM

- (31) ATMOSPHERIC VENT PIPE (NON-EEC EQUIPPED)
- (32) EEC PIPE (VAPOR CANISTER TO CARBURETOR)

### EEC SYSTEM (CONTINUED)

- (33) VAPOR RECOVERY HOSES (CANISTER TO CARBURETOR)
- (34) LIQUID-VAPOR SEPARATOR (UNLESS PART OF TANK)
- (35) CANISTER
- (39) EEC SYSTEM, DETAILS UNKNOWN

- (49) ENGINE COMPARTMENT, COMPONENT UNKNOWN
- (99) COMPONENT UNKNOWN

## II COMPONENT SOURCE

- (1) OEM
- (2) AFTER MARKET
- (9) UNKNOWN

## III TYPE OF DAMAGE

- (1) DENTED/CRUSHED
- (2) PUNCTURED
- (3) RUPTURED
- (4) SEVERED/GROSS TEARS
- (5) DISCONNECTED/DEFEATED
- (9) UNKNOWN

## IV SEVERITY OF DAMAGE

- (1) MINOR
- (2) MODERATE
- (3) SEVERE
- (4) DISCONNECTED/DEFEATED
- (9) UNKNOWN

## V LOCATION OF LEAK

FIRST DIGIT  
(LONGITUDINAL LOCATION)

- (1) F, FORWARD OF COWL
- (2) P, BETWEEN COWL & REAR BULKHEAD
- (3) B, BEHIND REAR BULKHEAD
- (4) Y, F, & P
- (5) Z, P, & B
- (6) D, DISTRIBUTED (F, P & B)
- (9) UNKNOWN

SECOND DIGIT  
(LATERAL LOCATION)

- (1) L, LEFT
- (2) C, CENTER
- (3) R, RIGHT
- (4) Y, LEFT CENTER (L & C)
- (5) Z, RIGHT CENTER (R & C)
- (6) D, DISTRIBUTED (F, P & B)
- (9) UNKNOWN

Duplicate columns 1-8  
from the previous card.

Module F R Format 0 1  
9 10 11 12

FIRE FR-1

WAS THERE FIRE IN OR ON CASE VEHICLE?

(0) NO SKIP PAGE.

(1) YES COMPLETE PAGE.



13

DID FIRE START IN CASE VEHICLE?

- (0) NO
- (1) YES
- (9) UNKNOWN

14

SEVERITY OF FIRE DAMAGE

- (1) MINOR
- (2) MODERATE
- (3) SEVERE
- (9) UNKNOWN

16

FLAME PROPOGATION RATE

- (1) RAPID/EXPLOSIVE
- (2) SLOW/MODERATE
- (9) UNKNOWN

15

DID AN INJURY TO CASE  
VEHICLE OCCUPANT RESULT FROM  
FIRE IN OR ON CASE VEHICLE?

- (0) NO
- (1) YES
- (9) UNKNOWN

17

PROVIDE NOTES IF FIRE OCCURRED.

## HOOD PERFORMANCE

FOR THE FOLLOWING, USE CODES:

- (0) NO
- (1) YES
- (8) NOT APPLICABLE
- (9) UNKNOWN

HOOD LATCH(ES)- -RELEASED

1  
13

-DAMAGED

1  
14

-JAMMED

1  
15

HOOD HINGES- -LEFT, DAMAGED

1  
16

-LEFT, SEPARATED  
(COMPLETE)

1  
17

-RIGHT, DAMAGED

1  
18

-RIGHT, SEPARATED  
(COMPLETE)

1  
19

HOOD REMAINED ON VEHICLE

1  
20

REAR EDGE OF HOOD- -ELEVATED

1  
21

-CONTACTED WINDSHIELD

1  
22

-PENETRATED WINDSHIELD

1  
23

HOOD LATCH LOCATION

- (1) FRONT OF VEHICLE
- (2) COWL AREA
- (3) SIDE
- (8) NOT APPLICABLE
- (9) UNKNOWN

1  
24

## ENGINE OR TRANSMISSION MOUNT

SEPARATION (COMPLETE)

- (0) NO
- (1) YES
- (9) UNKNOWN

9  
25

## STEERING COL FLEXIBLE COUPLING

FLEXIBLE COUPLING TYPE

- (0) NONE
- (1) FLEXIBLE MATERIAL
- (2) POT
- (3) SINGLE U-JOINT
- (4) DOUBLE U-JOINT
- (5) FLEXIBLE CABLE
- (6) COMBINATION OF ABOVE  
(CIRCLE EACH)
- (7) OTHER: \_\_\_\_\_
- (8) EQUIPPED, TYPE UNKNOWN
- (9) UNKNOWN, IF EQUIPPED

9  
26

COUPLING-

-DAMAGED

9  
27

(USE CODES  
FROM HOOD  
PERFORMANCE)

-SEPARATED  
(COMPLETE)

9  
28

## ENG COMPART TELESCOPING UNIT

TYPE OF UNIT

- (00) NONE INSTALLED
- (01) - (07) SEE UNITS ON PAGE ED-2
- (88) NOT COLLECTED
- (97) OTHER: \_\_\_\_\_
- (98) EQUIPPED, TYPE UNKNOWN
- (99) UNKNOWN IF EQUIPPED

8 8  
29 30

ORIGINAL LENGTH (mm)

F (OR H): \_\_\_\_\_

TELESCOPED LENGTH (mm)

G: \_\_\_\_\_

DIFFERENCE (mm)

F (OR H) - G

(IF LESS THAN 15mm, ENTER "000".)

- (888) NOT COLLECTED
- (991) NOT MEASURED/NO  
COMPRESSION
- (992) COMPRESSED, AMOUNT  
UNKNOWN
- (993) DEVICE EXTENDED
- (997) UNABLE TO BE MEASURED
- (998) NOT APPLICABLE (NOT  
EQUIPPED)
- (999) UNKNOWN

8 8 8  
31 32 33

## LEFT-SIDE BODY MOUNT

DID BODY MOUNT SEPARATE?

- (0) NO  
 (1) YES  
 (8) NOT APPLICABLE  
 (9) UNKNOWN

8  
 34

## LEFT DOORS

HOW DID DOORS  
OPEN DURING COLLISION?

USE CODES:

(0) DOOR DID NOT OPEN

OPENED BECAUSE OF

- (1) HINGE AREA SEPARATION  
 (2) DOOR-LATCH SEPARATION  
 (3) LATCH-STRIKER SEPARATION  
 (4) STRIKER-PILLAR SEPARATION  
 (5) BODY DISTORTION  
 (6) COMBINATION OF ABOVE  
 (CIRCLE EACH)  
 (7) OPENED, REASON UNKNOWN

- (8) NOT APPLICABLE (NO DOOR)  
 (9) UNKNOWN

## LEFT PILLARS

PILLARS SEPARATED COMPLETELY -

USE CODES:

- (0) NO  
 (1) YES  
 (4) NO SEPARATION, BUT DAMAGED  
 (8) NOT APPLICABLE (NOT EQUIPPED)  
 (9) UNKNOWN

-A-PILLAR, UPPER

⊙  
 35

LOWER

⊙  
 36

-B-PILLAR, UPPER

4  
 37

LOWER

⊙  
 38

-C-PILLAR, UPPER

4  
 39

LOWER

4  
 40

-D-PILLAR, UPPER

8  
 41

LOWER

8  
 42

-FRONT

⊙  
 43

-REAR

⊙  
 44

DOORS JAMMED CLOSED-

USE CODES:

- (0) NO  
 (1) YES  
 (8) NOT APPLICABLE (NO DOOR)  
 (9) UNKNOWN

-FRONT

⊙  
 45

-REAR

⊙  
 46

## REAR DOOR


## REAR DOOR TYPE

- (0) NO DOOR (INCLUDES PICKUPS)
- (1) HATCHBACK
- (2) ONE-WAY TAILGATE
- (3) TWO-WAY TAILGATE
- (4) CLAMSHELL/DISAPPEARING TAILGATE
- (5) SINGLE DOOR
- (6) DOUBLE DOOR
- (9) UNKNOWN


Hatchback



One-way



Two-way



Clamshell



Single door



Double door

HOW DID DOOR  
OPEN DURING COLLISION?

- (0) DOOR DID NOT OPEN

## OPENED BECAUSE OF

- (1) HINGE AREA SEPARATION
- (2) DOOR-LATCH SEPARATION
- (3) LATCH-STRIKER SEPARATION
- (4) STRIKER-PILLAR SEPARATION
- (5) BODY DISTORTION
- (6) COMBINATION OF ABOVE  
(CIRCLE EACH)
- (7) OPENED, REASON UNKNOWN
- (8) NOT APPLICABLE (NO DOOR)
- (9) UNKNOWN

## DOOR JAMMED CLOSED

- (0) NO
- (1) YES
- (8) NOT APPLICABLE (NO DOOR)
- (9) UNKNOWN

  
47

## OTHER REAR DAMAGE

WAS PARTITION TO LUGGAGE AREA  
DAMAGED DURING COLLISION?

- (0) NO
- (1) YES
- (8) NOT APPLICABLE
- (9) UNKNOWN

  
50

## SPARE TIRE

- (0) NO SPARE TIRE
- (1) NOT ATTACHED BEFORE COLLISION
- (2) ATTACHED, NOT SEPARATED IN COLLISION
- (3) ATTACHED, SEPARATED DUE TO COLLISION
- (8) NOT COLLECTED
- (9) UNKNOWN

  
51

## TRAILER HITCH TYPE

- (0) NO HITCH

## BALL-AND-SOCKET TYPES

- (1) TEMPORARY FRAMEWORK (E.G. RENTAL CLAMP-ON)
- (2) BUMPER-MOUNT ONLY (E.G. LIGHT TRUCK)
- (3) BUMPER-AND-FRAME (BUT NON-EQUALIZING)
- (4) LOAD EQUALIZING

## OTHER TYPES

- (5) RING-AND-PINTLE
- (6) FIFTH-WHEEL (INCL. P/U)
- (7) OTHER (E.G. CLEVIS-AND-PIN)

- (8) EQUIPPED, TYPE UNKNOWN
- (9) UNKNOWN IF EQUIPPED

  
52
TRAILER TYPE  
(AT TIME OF COLLISION)

- (0) NO TRAILER
- (1) TRAVEL-TRAILER/CAMPER
- (2) MOBILE HOME
- (3) BOAT/SNOWMOBILE/ATV TRAILER
- (4) UTILITY TRAILER
- (5) TOWED CAR
- (7) OTHER: \_\_\_\_\_
- (8) TRAILER, TYPE UNKNOWN
- (9) UNKNOWN

  
53


  
48


  
49



## RIGHT-SIDE BODY MOUNT

DID BODY MOUNT SEPARATE?

- (0) NO  
 (1) YES  
 (8) NOT APPLICABLE  
 (9) UNKNOWN

8  
 54

## RIGHT DOORS

HOW DID DOORS  
OPEN DURING COLLISION?

USE CODES:

(00) DOOR DID NOT OPEN

OPENED BECAUSE OF

- (01) HINGE AREA SEPARATION  
 (02) DOOR-LATCH SEPARATION  
 (03) LATCH-STRIKER SEPARATION  
 (04) STRIKER-PILLAR SEPARATION  
 (05) BODY DISTORTION  
 (06) COMBINATION OF ABOVE  
 (CIRCLE EACH)  
 (07) OPENED, REASON UNKNOWN  
 (11) VAN RIGHT-REAR DOOR OPENED  
 (ANY MECHANISM)

(98) NOT APPLICABLE (NO DOOR)

(99) UNKNOWN

## RIGHT PILLARS

PILLARS SEPARATED COMPLETELY -

USE CODES:

- (0) NO  
 (1) YES  
 (4) NO SEPARATION, BUT DAMAGED  
 (8) NOT APPLICABLE (NOT EQUIPPED)  
 (9) UNKNOWN

-A-PILLAR, UPPER

0  
 55

LOWER

0  
 56

-B-PILLAR, UPPER

0  
 57

LOWER

0  
 58

-C-PILLAR, UPPER

4  
 59

LOWER

4  
 60

-D-PILLAR, UPPER

8  
 61

LOWER

8  
 62

-FRONT

0 0  
 63 64

-REAR

0 0  
 65 66

## DOORS JAMMED CLOSED-

USE CODES:

- (0) NO  
 (1) YES  
 (8) NOT APPLICABLE (NO DOOR)  
 (9) UNKNOWN

-FRONT

0  
 67

-REAR

1  
 68

## VAN REAR DOOR TYPE

- (0) VAN, NO REAR DOOR  
 (1) TRACK (SLIDING) - RIGHT SIDE  
 (2) SINGLE-HINGED - RIGHT SIDE  
 (3) DOUBLE-HINGED - RIGHT SIDE  
 (4) TRACK (SLIDING) - RIGHT & LEFT SIDE  
 (5) SINGLE-HINGED - RIGHT & LEFT SIDE  
 (6) DOUBLE-HINGED - RIGHT & LEFT SIDE  
 (7) TRACK AND HINGED COMBINATION  
 (8) NOT APPLICABLE (NOT A VAN)  
 (9) UNKNOWN

8  
 69

# WINDSHIELD DAMAGE

## WINDSHIELD CRACKED

- (0) NO
- (1) YES
- (8) NOT APPLICABLE
- (9) UNKNOWN

## WINDSHIELD BROKEN (PLASTIC INTERLAYER TORN)

- (0) NO
- (1) YES
- (8) NOT APPLICABLE
- (9) UNKNOWN

## CRACKED OR BROKEN BY OCCUPANT CONTACT

- (0) NO
- (1) YES
- (8) NOT APPLICABLE
- (9) UNKNOWN

## EXTENT OF BOND SEPARATION

- (0) NONE
- (1) 1 - 20%
- (2) 21 - 40
- (3) 41 - 60
- (4) 61 - 80
- (5) 81 - 99
- (6) TOTAL
- (7) SEPARATED, AMOUNT UNKNOWN
- (8) NOT APPLICABLE
- (9) UNKNOWN

1  
70

Φ  
71

Φ  
72

Φ  
73

## WINDSHIELD MARK ON CASE VEHICLE:



DOT 46 OM4 AS1 1A  
NOM 1016-1 CERTIFIED  
8AC

(E) 43

## WINDSHIELD CODE

- (97) DESCRIBED BUT NOT CODED
- (98) NOT APPLICABLE (NO WINDSHIELD)
- (99) UNKNOWN

97  
74 75


## ROOF

### DID T-ROOF/SUN ROOF OPEN DURING COLLISION?

- (0) NO
- (1) YES
- (8) NOT APPLICABLE  
(NOT A T-ROOF OR SUN ROOF)
- (9) UNKNOWN

8  
76

LOCATE AREA OF WINDSHIELD INTEREST OR DAMAGE WITH DIMENSIONS (VERTICAL & HORIZONTAL) ON THIS DIAGRAM OF THE WINDSHIELD AS VIEWED FROM INSIDE.

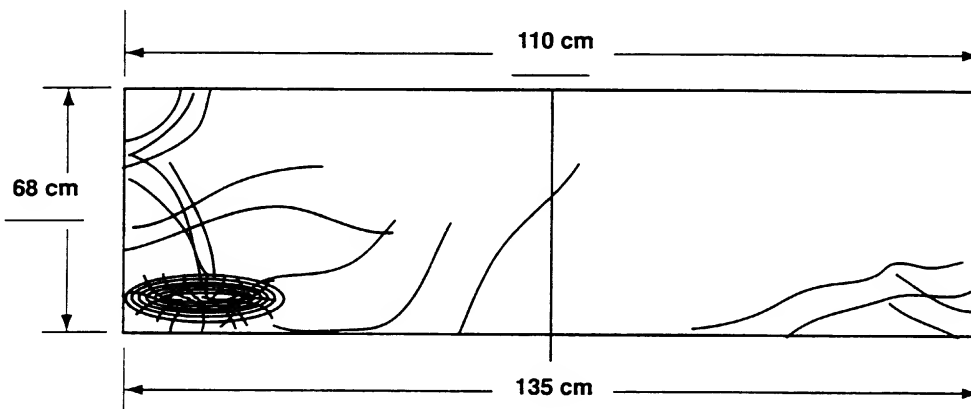

## STEERING WHEEL

### STEERING WHEEL RIM DAMAGE

- (0) NONE  
(1) DEFORMED SLIGHTLY  
(2) SEVERELY BENT  
(3) BROKEN  
(9) UNKNOWN

1  
13

### NUMBER OF STEERING WHEEL SPOKES

- (9) UNKNOWN

4  
14

### STEERING WHL SPOKE DAMAGE

- (0) NONE  
(1) DEFORMED SLIGHTLY  
(2) SEVERELY BENT  
(3) BROKEN  
(9) UNKNOWN

1  
15

### STEERING WHEEL POSITION AT TIME OF COLLISION

IN WHAT O'CLOCK POSITION WAS THE  
NORMAL TOP OF THE WHEEL POINTED  
WHEN THE COLLISION OCCURRED?

#### EXAMPLES

O'CLOCK = 1 2



(NORMAL STRAIGHT  
AHEAD)

O'CLOCK = 0 2




O'CLOCK =     

(99) UNKNOWN


## STEERING WHEEL ENERGY ABSORBING DEVICE

#### (1) EXAMPLES:

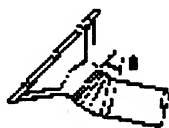

BARRACUDA, 70 - 74  
CHALLENGER, 70 - 74  
CAPRI, 71 - 77

#### (2) EXAMPLES:

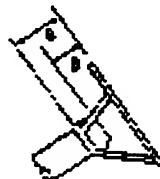

OMNI, 78 -  
HORIZON, 78 -

## STEERING COLUMN OPTIONS

### TILT FEATURE

- (0) NOT EQUIPPED  
(1) YES, EQUIPPED, UNK POSITION  
(2) UP  
(3) MIDDLE  
(4) LOWER  
(9) UNKNOWN IF EQUIPPED

2  
16

### SWING-AWAY FEATURE

- (0) NOT EQUIPPED  
(1) YES, EQUIPPED  
(9) UNKNOWN IF EQUIPPED

0  
17

### TELESCOPING FEATURE

- (0) NOT EQUIPPED  
(1) YES, EQUIPPED  
(9) UNKNOWN IF EQUIPPED

0  
18

### TYPE OF DEVICE

- (0) NONE  
(1) CONVOLUTED OR MESH CYLINDER  
(2) DEEP DISH STEERING WHEEL  
(7) OTHER: \_\_\_\_\_  
(8) NOT COLLECTED  
(9) UNKNOWN IF EQUIPPED

### ORIGINAL DIMENSION (mm)

A: \_\_\_\_\_

### DAMAGE DIMENSION (mm)

B: \_\_\_\_\_

### DIFFERENCE (mm)

#### A - B

- (888) NOT COLLECTED  
(991) NOT MEASURED/NO APPARENT COMPRESSION  
(992) COMPRESSED, AMOUNT UNKNOWN  
(993) DEVICE EXTENDED  
(997) UNABLE TO MEASURE  
(998) NOT APPLICABLE (NOT EQUIPPED)  
(999) UNKNOWN

8  
19

8 8 8  
20 22

# STEERING COLUMN ENERGY ABSORBING DEVICE

TYPE OF DEVICE \* (IF 27 OR 28)

- (00) NOT EQUIPPED  
(88) NOT COLLECTED  
(99) UNKNOWN

8 8  
23 24

ORIGINAL LENGTH (mm)

C: \_\_\_\_\_

COMPRESSED LENGTH (mm)

D: \_\_\_\_\_

BRACKET DEFLECTION (IF CODE 36, 48,  
OR 49 ABOVE)

OR

COMPRESSION (OR EXTRUSION) (mm)

C - D (OR E) (TOLERANCE:  $\pm 10$ )

- (888) NOT COLLECTED  
(991) NOT MEASURED/NO APPARENT  
COMPRESSION  
(992) COMPRESSED, AMOUNT UNKNOWN  
(993) DEVICE EXTENDED  
(997) UNABLE TO BE MEASURED  
(998) NOT APPLICABLE (NOT EQUIPPED)  
(999) UNKNOWN


8 8 8  
25 27

\* (ADD A &amp; B FOR TOTAL COMPRESSION)

SHEAR CAPSULE SEPARATION (mm)

S (USE AVG. OF LEFT &amp; RIGHT CAPSULES.)

LT:

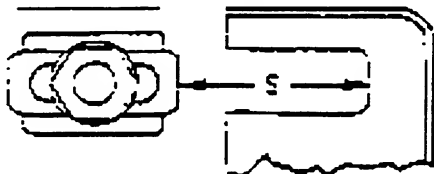

RT:

- (888) NOT COLLECTED  
(991) NOT MEASURED/NO APPARENT  
SEPARATION  
(992) SEPARATED, AMOUNT UNKNOWN  
(997) UNABLE TO BE MEASURED  
(998) NOT APPLICABLE (NOT EQUIPPED)  
(999) UNKNOWN

8 8 8  
28 30

## COLUMN VERTICAL ROTATION

- (0) NO APPARENT ROTATION  
(1) UPWARD APPARENT ROTATION  
(2) DOWNWARD APPARENT ROTATION  
(9) UNKNOWN

0  
31

## COLUMN LATERAL ROTATION

- (0) NO APPARENT ROTATION  
(1) LEFT APPARENT ROTATION  
(2) RIGHT APPARENT ROTATION  
(9) UNKNOWN

2  
32

## STEERING WHEEL (CONTINUED)

## STEERING WHEEL HUB DAMAGE

- (0) NONE  
(1) OCCUPANT CONTACT  
(2) AIRBAG  
(3) OTHER \_\_\_\_\_  
(9) UNKNOWN

0  
33

**This page left intentionally blank.**




1 = Definitely 2 = Probably 3 = Possible

### INTRUSION IT-1

Location of Intrusion	Intruded Component	(All Measurements Are in Centimeters)					Dominant Crush Direction
		Comparison Value	–	Intruded Value	=	Intrusion	
21	Rear seatback	100	–	60	=	40	forward
22	Rear seatback	100	–	66	=	34	forward
23	Rear seatback	100	–	72	=	28	forward
			–		=		
			–		=		
			–		=		
			–		=		
			–		=		
			–		=		
			–		=		
			–		=		
			–		=		
			–		=		
			–		=		

### OCCUPANT CONTACT WORKSHEET

Contact	Interior Component Contacted	Occupant No. if Known	Body Region if Known	Supporting Physical Evidence	Confidence Level of Contact Point
A	Knee bolster	1	Knee	Scuff mark	1
B	Knee bolster	1	Knee	Scuff mark	1
C					
D					
E					
F					
G					
H					
I					
J					
K					

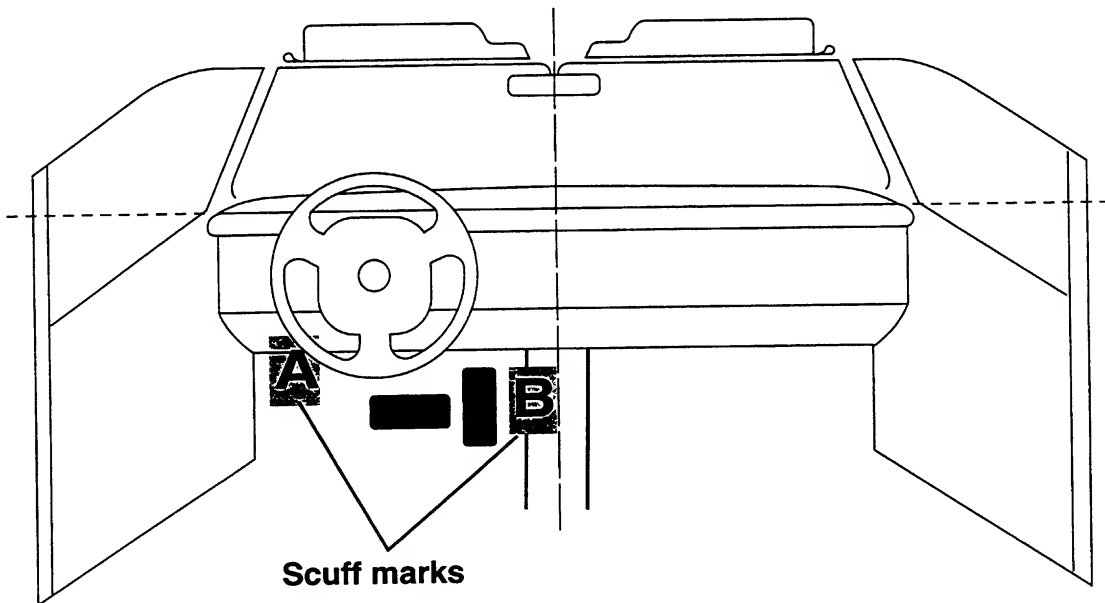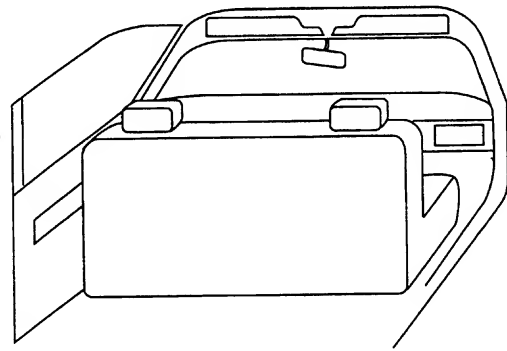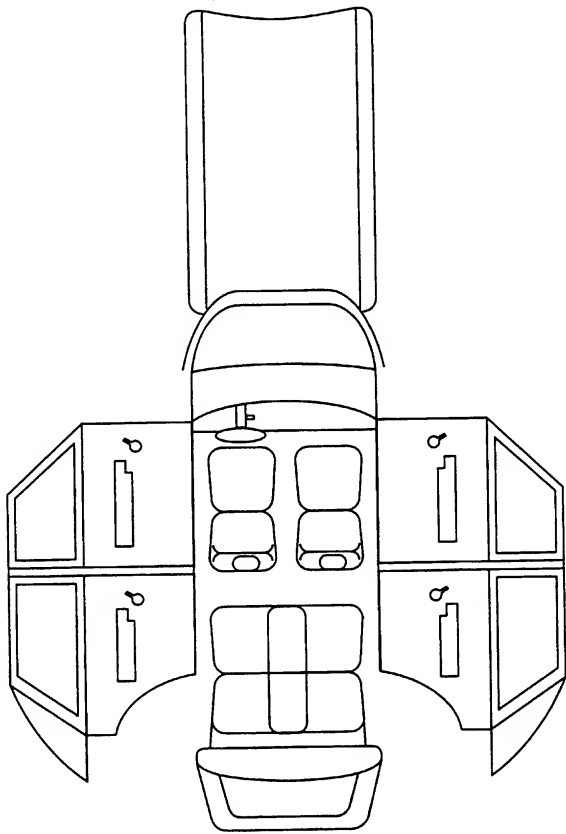

## CODES FOR COLUMN B, OCCUPANT SPACE NUMBER

OCCUPANT SPACE NUMBER IS A TWO-DIGIT CODE. THE USE OF THE CODE IS DETERMINED BY THE VEHICLE SEAT CONFIGURATION AT THE TIME OF THE ACCIDENT.

## FIRST DIGIT

THE FIRST DIGIT (LEFT DIGIT) DENOTES THE SEAT ROW, WITH CODE VALUES FROM 1 TO 5.

## SECOND DIGIT

THE SECOND DIGIT (RIGHT DIGIT) DENOTES THE POSITION ON THE SEAT AND, IN SOME INSTANCES, THE WIDTH OF THE SEAT.

- |                          |                 |                         |   |
|--------------------------|-----------------|-------------------------|---|
| (1) LEFT                 | (3) RIGHT       | .....                   | INDIVIDUAL SEAT                               |
| (1) LEFT                 | (2) CENTER      | (3) RIGHT               | ..... BENCH: FULL WIDTH 3 PASSENGER           |
| (1) LEFT                 | (2) LEFT CENTER | (6) RIGHT CENTER        | (3) RIGHT ..... BENCH: FULL WIDTH 4 PASSENGER |
| (1) LEFT                 | (2) CENTER      | (5) RIGHT & AISLE SPACE | ..... BENCH: PARTIAL WIDTH, LEFT              |
| (0) LEFT & SPACE         | (2) CENTER      | (5) RIGHT & SPACE       | ..... BENCH: PARTIAL WIDTH, CENTERED          |
| (4) ENTIRE VEHICLE WIDTH | .....           | CARGO AREA              |   |

## EXAMPLES

THE TWO FIGURES BELOW PROVIDE EXAMPLES OF THE OCCUPANT SPACE NUMBER.

PASSENGER CAR  
5 PASSENGERS

X	X	11	13
X	X	X	21 22 23

VAN  
12 PASSENGER CAPACITY

X	X	11	13
X	X	X	21 22 25
X	X	X	31 32 35
X	X	X	X 41 42 46 43

## CODES FOR COLUMN F, MEASUREMENT AXIS

- (X) X-AXIS (FORE & AFT)  
(Y) Y-AXIS (LATERAL)  
(Z) Z-AXIS (VERTICAL)

## CODES FOR COLUMNS G, H, I &amp; J, OCCUPANT &amp; INJURY NUMBERS

OCCUPANT NUMBER	INJURY NUMBER	<u>CONTACT</u>
(00)	(00)	NO CONTACT
(##)	(00)	CONTACT, NO INJURY
(97)	(99)	CONTACT, OCCUPANT UNKNOWN, INJURY UNKNOWN
(99)	(00) OR (99)	UNKNOWN IF CONTACT





## CODES FOR COLUMN C, INTRUDING COMPONENT OR OBJECT

*NOTE: DO NOT CODE OBJECTS OTHER THAN COMPONENTS OF CASE VEHICLE.*

## INDIVIDUAL COMPONENT

## INTERNAL

- (01) INSTRUMENT PANEL
- (02) FIRE WALL
- (03) TOE PAN
- (04) FLOOR PAN
- (05) STEERING COLUMN
- (06) WINDSHIELD
- (07) WINDSHIELD HEADER
- (08) A-PILLAR
- (09) DOOR PANEL OR SIDE PANEL
- (10) WINDOW FRAME
- (11) B-PILLAR
- (12) C-PILLAR
- (13) D-PILLAR
- (14) ROOF SIDE RAILS
- (15) ROOF OR CONVERTIBLE TOP
- (16) BACKLIGHT HEADER
- (17) FRONT SEAT-BACK SURFACE/  
SEAT-BACK BACK SURFACE
- (18) SECOND SEAT-BACK SURFACE  
SEAT-BACK BACK SURFACE
- (19) THIRD SEAT-BACK SURFACE  
SEAT-BACK BACK SURFACE
- (20) FOURTH SEAT-BACK SURFACE  
SEAT-BACK BACK SURFACE
- (21) FIFTH SEAT-BACK SURFACE  
SEAT-BACK BACK SURFACE
- (22) BACK PANEL/BACK DOOR SURFACE
- (23) SEAT CUSHION SURFACE/EDGE
- (24) CONSOLE
- (25) OTHER (*DESCRIBE*)
- (26) UNKNOWN INTERNAL SURFACES
- (28) TRANSMISSION TUNNEL (HUMP)
- (29) SIDE FOOTWELL PANEL (KICKPANEL)
- (30) SILL

## EXTERNAL

- (43) HOOD
- (44) OBJECT EXTERNAL TO PASSENGER  
COMPARTMENT BUT PART  
OF CASE VEHICLE
- (45) OUTSIDE SURFACE OF CASE VEHICLE
- (46) OTHER (*E.G. SPARE TIRE,  
JACK. DESCRIBE.*)
- (49) UNKNOWN EXTERNAL OBJECT

## GROUPED FOR MASSIVE INTRUSION INTO AN OCCUPANT SPACE

*USE ONLY IF ALL THESE COMPONENTS  
INTRUDED INTO A SINGLE OCCUPANT SPACE.*

- |                        |                         |
|------------------------|-------------------------|
| (50) WINDSHIELD HEADER | (60) ROOF               |
| A-PILLAR               | ROOF RAIL               |
| ROOF SIDE RAIL         | A-PILLAR                |
|                        | B-PILLAR                |
| (51) INSTRUMENT PANEL  | C-PILLAR                |
| A-PILLAR               | WINDOW FRAME            |
| DOOR PANEL             | DOOR PANEL              |
|                        | FLOOR PAN               |
| (52) INSTRUMENT PANEL  |                         |
| A-PILLAR               | (61) INSTRUMENT PANEL   |
| WINDSHIELD HEADER      | TOE PAN                 |
|                        | WINDSHIELD HEADER       |
| (53) DOOR PANEL        | A-PILLAR                |
| B-PILLAR               | ROOF RAIL               |
| ROOF RAIL              | WINDOW FRAME            |
|                        | DOOR PANEL              |
| (54) DOOR PANEL        | ROOF                    |
| A-PILLAR               |                         |
| ROOF RAIL              | (62) ROOF               |
|                        | ROOF RAIL               |
| (55) INSTRUMENT PANEL  | C-PILLAR                |
| FLOOR PAN              | WINDOW FRAME            |
| A-PILLAR               | FLOOR PAN               |
| DOOR FRAME             | SECOND SEAT             |
|                        | DOOR PANEL              |
| (56) ROOF RAIL         |                         |
| A-PILLAR               | (63) ROOF RAIL          |
| B-PILLAR               | ROOF                    |
| WINDOW FRAME           | B-PILLAR                |
|                        | WINDOW FRAME            |
| (57) ROOF RAIL         | FLOOR PAN               |
| A-PILLAR               | DOOR PANEL              |
| B-PILLAR               | SECOND SEAT             |
| C-PILLAR               | FRONT SEAT              |
| DOOR PANEL             |                         |
|                        | (64) ROOF RAIL          |
| (58) ROOF              | ROOF OR CONVERTIBLE TOP |
| ROOF RAIL              | A-PILLAR                |
| WINDOW FRAME           | B-PILLAR                |
| DOOR PANEL             | WINDOW FRAME            |
|                        | WINDOW HEADER           |
| (59) BACKLIGHT HEADER  |                         |
| ROOF                   | (65) WINDSHIELD         |
| C-PILLAR               | WINDSHIELD HEADER       |
| THIRD SEAT-BACK        | ROOF SIDE RAIL          |
|                        |                         |
|                        | (66) WINDSHIELD         |
|                        | WINDSHIELD HEADER       |
|                        | A-PILLAR                |
|                        |                         |
|                        | (98) NOT APPLICABLE     |
|                        | (99) UNKNOWN            |

Duplicate columns 1-8  
from the previous card.

Module 1 T Format 0 1  
9 10 11 12

INTRUSION IT-5

WAS THERE OCCUPANT COMPARTMENT INTRUSION? 1

13

WAS INTRUSION CATASTROPHIC? 0

14

- (0) NO DO NOT ANSWER NEXT QUESTION. SKIP PAGE.  
(1) YES ANSWER NEXT QUESTION.  
(9) UNKNOWN SKIP PAGE.

- (0) NO COMPLETE PAGE.  
(1) YES SKIP PAGE.

Duplicate columns 1-8  
from the previous card.

Module 1 T Format 0 2  
9 10 11 12

NOTE: Each line in the table below is a separate record (card). Duplicate columns 1 - 12 for each completed line.

**INTRUSIONS** CODE INTRUSIONS IN THIS ORDER: LEFT TO RIGHT ON ROW; FRONT TO BACK IN VEHICLES.  
CODES FOR B, F, G, H, I, J ON PAGE IT-3  
CODES FOR C ON PAGE IT-4

OCCUPANT CONTACT AND INJURY

A	B	C	D	E	F	G	H	I	J	K
INTRUSION NUMBER	OCC. SPACE NO.	INTRUDING COMPONENT OR OBJECT	ASSOC. EVENT NO.	MAXIMUM INTRUSION X AXIS (cm)	MAXIMUM INTRUSION Y AXIS (cm)	MAXIMUM INTRUSION Z AXIS (cm)	OCCUPANT NUMBER	INJURY NUMBER	OCCUPANT NUMBER	INJURY NUMBER
13-14	15-16	17-18	19	20-21	22-23	24-25	26-27	28-29	30-31	32-33
<u>0 1</u>	<u>21</u>	<u>18</u>	<u>1</u>	<u>40</u>	<u>00</u>	<u>00</u>	<u>00</u>	<u>00</u>	<u>00</u>	<u>00</u>
<u>0 2</u>	<u>22</u>	<u>18</u>	<u>1</u>	<u>34</u>	<u>00</u>	<u>00</u>	<u>00</u>	<u>00</u>	<u>00</u>	<u>00</u>
<u>0 3</u>	<u>23</u>	<u>18</u>	<u>1</u>	<u>28</u>	<u>00</u>	<u>00</u>	<u>00</u>	<u>00</u>	<u>00</u>	<u>00</u>
<u>0 4</u>	—	—	—	—	—	—	—	—	—	—
<u>0 5</u>	—	—	—	—	—	—	—	—	—	—
<u>0 6</u>	—	—	—	—	—	—	—	—	—	—
<u>0 7</u>	—	—	—	—	—	—	—	—	—	—

NOTE: USE ADDITIONAL PAGE IF MORE THAN 7 INTRUSIONS.

Duplicate columns 1-8  
from the previous card.

Module 1 T Format 0 3  
9 10 11 12

NOTE: IF NO SIDE DOOR INTRUSION,  
SKIP REMAINDER OF PAGE.

**SIDE DOOR INTRUSION  
RESULTED FROM**

INTRUSION  
NUMBER CAUSE

CODES  
FOR CAUSE:

- |           |           |             |
|-----------|-----------|-------------|
| <u>13</u> | <u>15</u> | (1) DIRECT  |
| <u>16</u> | <u>18</u> | IMPACT      |
| <u>19</u> | <u>21</u> | (2) INDUCED |
|           |           | DAMAGE      |
|           |           | (9) UNKNOWN |

**IF DAMAGE TO DOOR COMPONENT RESULTED IN INCREASED  
DOOR INTRUSION, CODE COMPONENT**

INTRUSION  
NUMBER

DAMAGED  
COMPONENT 1

DAMAGED  
COMPONENT 2

CODES  
FOR COMPONENTS

A 22 23

25

B 26 27

29

C 30 31

33

D 34 35

37

- (0) NONE  
(1) A-PILLAR  
(2) B-PILLAR  
(3) C-PILLAR  
(4) LATCH/STRIKER  
(5) HINGES  
(7) OTHER: \_\_\_\_\_  
(8) NOT APPLICABLE  
(9) UNKNOWN

Duplicate columns 1-8 from the previous card. Module 1 T Format 0 2  
9 10 11 12

INTRUSION IT-6

NOTE: Each line in the table below is a separate record (card).  
Duplicate columns 1 - 12 for each completed line.

- ADDITIONAL PAGE -

INTRUSIONS CODE INTRUSIONS IN THIS ORDER: LEFT TO RIGHT ON ROW; FRONT TO BACK IN VEHICLES.  
CODES FOR B, F, G, H, I, J ON PAGE IT-3  
CODES FOR C ON PAGE IT-4

OCCUPANT CONTACT AND INJURY

A	B	C	D	E	F	G	H	I	J	K
INTRUSION NUMBER	OCC. SPACE NO.	INTRUDING COMPONENT OR OBJECT	ASSOC. EVENT NO.	MAXIMUM INTRUSION X AXIS (cm)	MAXIMUM INTRUSION Y AXIS (cm)	MAXIMUM INTRUSION Z AXIS (cm)	OCCUPANT NUMBER	INJURY NUMBER	OCCUPANT NUMBER	INJURY NUMBER
13-14	15-16	17-18	19	20-21	22-23	24-25	26-27	28-29	30-31	32-33
<u>0 8</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0 9</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 0</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 1</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 2</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 3</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 4</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 5</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 6</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 7</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 8</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 9</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>2 0</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>2 1</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>2 2</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>2 3</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>2 4</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>2 5</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —

Duplicate columns 1-8  
from the previous card.

Module I D Format 0 1  
9 10 11 12

# INTERIOR DAMAGE

ID-1

## CODES:

- |                              |                               |
|------------------------------|-------------------------------|
| (0) NO                       | (4) YES, and OCCUPANT CONTACT |
| (1) YES                      | (8) NOT APPLICABLE            |
| (3) NO, and OCCUPANT CONTACT | (9) UNKNOWN                   |

	LEFT	RIGHT				
<b>SIDES</b>			<b>FRONT</b>		<b>INSTRUMENT PANEL</b>	
FRONT DOOR	⊖ 13	⊖ 14	FOOT CONTROLS	⊖ 45	UPPER PANEL	⊖ 55
FRONT HARDWARE	⊖ 15	⊖ 16	IGNITION KEYS	⊖ 46	MID PANEL	⊖ 56
FRONT ARMREST	⊖ 17	⊖ 18	REAR VIEW MIRROR	⊖ 47	LOWER PANEL	3 57
FRONT GLASS	⊖ 19	⊖ 20	SUNVISOR/FITTINGS	⊖ 48	ASHTRAY	⊖ 58
REAR DOOR AREA	 21	 22	(5) LEFT SIDE ONLY (6) RIGHT SIDE ONLY (7) BOTH SIDES		CONTROL KNOBS & LEVERS	⊖ 59
REAR HARDWARE	 23	⊖ 24	WINDSHIELD TOP MOLDINGS	⊖ 49	GLOVE COMPARTMENT AREA	⊖ 60
REAR ARMREST	 25	⊖ 26	LEFT A-PILLAR (UPPER OR LOWER)	⊖ 50	INSTRUMENTS	⊖ 61
REAR GLASS	 27	 28	RIGHT A-PILLAR (UPPER OR LOWER)	⊖ 51	PARKING BRAKE RELEASE	⊖ 62
ROOF SIDE RAIL	 29	 30	CENTER CONSOLE	⊖ 52	PARKING BRAKE PEDAL	8 63
B-PILLAR	 31	⊖ 32	TRANSMISSION SELECTOR LEVER	⊖ 53	A/C OR UPPER VENT OUTLETS	⊖ 64
C-PILLAR	 33	⊖ 34	RIM, HORN, SPOKE	⊖ 54	HEATER OR A/C DUCTS	⊖ 65
D-PILLAR	⊖ 35	⊖ 36	<i>Deformed via loading of airbag</i>		RADIO	⊖ 66
HEADLINING	⊖ 37	⊖ 38			OTHER: * _____	8 67
ROOF STRUCTURE	 39	 40				
T-ROOF/SUN ROOF	⊖ 41	⊖ 42				
OTHER: * _____	⊖ 43	⊖ 44				
					<b>REAR</b>	
					WINDOW	 68
					WINDOW HEADER	 69
					<b>CONSOLES</b>	
					VERTICAL	⊖ 70
					ROOF	8 71

\* MORE THAN ONE ITEM MAY BE NOTED.

FRONT SEAT	DRIVER	PASSENGER	FRONT SEAT-BACK	DRIVER	PASSENGER
<b>TYPE OF FRONT SEAT</b> (00) NO SEAT (01) STANDARD BENCH (02) SPLIT BACK, 50-50 (03) SPLIT BACK, DRIVER WIDE (04) SPLIT BACK, PASS. WIDE (05) BUCKET (06) CAPTAIN'S CHAIR (07) INDIV. BENCH, 50-50 (08) INDIV. BENCH, DRIVER WIDE (09) INDIV. BENCH, PASS. WIDE (97) OTHER: _____ (99) UNKNOWN	<u>05</u> 13 14	<u>05</u> 15 16	<b>SEAT-BACK TYPE</b> (1) FORWARD FOLDING (2) RIGID (3) RECLINING (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN	<u>3</u> 30	<u>3</u> 31
<b>TYPE OF SEAT MOUNT</b> (1) STANDARD (2) PEDESTAL (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN	<u>1</u> 17	<u>1</u> 18	<b>SEAT-BACK LOCK TYPE</b> (0) NONE (1) MANUAL (2) INERTIA (3) POWER (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN	<u>1</u> 32	<u>1</u> 33
<b>SWIVEL MECHANISM EQUIPPED</b> (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN	<u>0</u> 19	<u>0</u> 20	<b>LOCKS HELD</b> (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN	<u>1</u> 34	<u>1</u> 35
<b>ORIGINAL EQUIPMENT SEATS</b> (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN	<u>1</u> 21	<u>1</u> 22	<b>RECLINER MECHANISM HELD</b> (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN	<u>0</u> 36	<u>1</u> 37
<b>CONTACT OF SEAT BY REAR OCCUPANT</b> (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN	<u>8</u> 23	<u>8</u> 24	<b>HEAD RESTRAINT</b> <b>HEAD RESTRAINT TYPE</b> (0) NONE (1) ADJUSTABLE (2) INTEGRAL (3) NOT INTEGRAL, BUT CANNOT BE REMOVED (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN	<u>1</u> 38	<u>1</u> 39
<b>FRONT SEAT DAMAGE</b> (0) NONE (1) BACKREST ONLY DAMAGED (2) CUSHION ONLY DAMAGED (3) BACKREST & CUSHION DAMAGED (8) NOT APPLICABLE (9) UNKNOWN	<u>0</u> 25	<u>0</u> 26	<b>REMOVED PRE-CRASH</b> (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN	<u>0</u> 40	<u>0</u> 41
<b>CENTER ARMREST DAMAGED</b> (0) NO (1) YES (7) EQUIPPED, DAMAGE UNKNOWN (8) NOT APPLICABLE (NO CENTER ARMREST) (9) UNKNOWN IF EQUIPPED	<u>0</u> 27		<b>ADJUSTMENT AT CRASH</b> (1) UP (2) DOWN (8) NOT APPLICABLE (9) UNKNOWN	<u>1</u> 42	<u>1</u> 43
<b>FRONT SEAT ROTATION</b> (0) NONE APPARENT (1) FORWARD APPARENT (2) REARWARD APPARENT (3) LEFT APPARENT (4) RIGHT APPARENT (5) MULTIPLE ROTATIONS SPECIFY _____ (8) NOT APPLICABLE (9) UNKNOWN	<u>0</u> 28	<u>0</u> 29	<b>HEAD RESTRAINT DAMAGE</b> (0) NONE (1) DAMAGED BUT NOT SEPARATED (2) SEPARATED (8) NOT APPLICABLE (9) UNKNOWN	<u>0</u> 44	<u>0</u> 45


SEATS ST-2						
<b>FRONT SEAT ADJUSTMENT</b> <b>SEAT ADJUSTMENT TYPE</b> (0) NONE (RIGID) (1) MANUAL (2) POWER (7) OTHER: _____ (8) NOT APPLICABLE (NO SEAT) (9) UNKNOWN  <b>ADJUSTMENT PROVIDED</b> (1) 2-WAY (2) 4-WAY (3) 6-WAY (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN  <b>SEAT ADJUSTER DAMAGE</b> (0) NONE (1) CHUCKING (FREE PLAY) (2) DEFORMED (RELEASED/JAMMED) (3) SEPARATED (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN  <b>SEAT ADJUSTER SEPARATION</b> (0) NONE (1) SEPARATED AT FLOOR (2) SEPARATION OF ADJUSTER (3) SEPARATED AT SEAT (8) NOT APPLICABLE (9) UNKNOWN  <b>PRE-CRASH POSITION</b> (1) FORWARD (2) MIDDLE (3) REARWARD (8) NOT APPLICABLE (9) UNKNOWN	<b>DRIVER</b>  L 46	<b>PASSENGER</b>  1 47	<b>SECOND SEAT (CONT.)</b>  <b>CENTER ARMREST DAMAGED</b> (0) NO (1) YES (7) EQUIPPED, DAMAGE UNKNOWN (8) NOT APPLICABLE (NO CENTER ARMREST) (9) UNKNOWN IF EQUIPPED	8 60		
		2 48	2 49	<b>SECOND SEAT-BACK</b>  <b>LOCKS</b>  <b>FOR THE FOLLOWING, USE:</b> (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN  <b>LEFT OR CENTER, EQUIPPED</b>  <b>LEFT OR CENTER, HELD</b> (3) SEAT FOLDED DOWN  <b>RIGHT, EQUIPPED</b>  <b>RIGHT, HELD</b> (3) SEAT FOLDED DOWN	<b>LEFT</b>  1 61 1 63 0 65 8 67	<b>RIGHT</b>  0 62 8 64 1 66 1 68
		0 50	0 51			
		8 52	8 53			
		2 54	9 55			
<b>SECOND SEAT</b> <b>TYPE OF SECOND SEAT</b> (0) NONE (1) NON-FOLDING (2) FOLDING (3) CAPTAIN'S CHAIR (4) JUMP SEAT (5) INTEGRAL CHILD SEAT (6) LUGGAGE AREA ACCESS PANEL (9) UNKNOWN  <b>SECOND SEAT DAMAGE</b> (0) NONE (1) BACKREST ONLY (DAMAGED OR LOOSENED) (2) CUSHION ONLY (DAMAGED OR LOOSENED) (3) BACKREST & CUSHION (DAMAGED OR LOOSENED) (4) INTEGRAL CHILD SEAT (PRIORITY CODE) (5) LUGGAGE AREA ACCESS PANEL (DAMAGED OR LOOSENED) (8) NOT APPLICABLE (9) UNKNOWN	<b>LEFT</b>  6 56	<b>RIGHT</b>  6 57	<b>THIRD SEAT</b>  <b>EQUIPPED</b>  <b>BACKREST DAMAGED</b>  <b>CUSHION DAMAGED</b>	0 69 8 71 8 73	0 70 8 72 8 74	
			<b>VEHICLE EQUIPPED WITH REAR HEAD RESTRAINTS</b>  (0) NOT EQUIPPED (OR REMOVED) (1) EQUIPPED (2) EQUIPPED & DAMAGED (8) NOT APPLICABLE (NO REAR SEAT) (9) UNKNOWN  <i>Applies to any rear-seat position</i>	1 75		
		3 58	3 59			

<p>DRIVER SIDE</p> <p>LOCATION OF AIRBAG</p> <p>STEERING WHEEL</p> <p>EQUIPPED</p> <p>(0) NO (1) YES (4) PRIOR DEPLOYMENT NOT REINSTALLED (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>DEPLOYED</p> <p>(0) NO (1) YES (2) PARTIAL/IMPROPER DEPLOYMENT (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 13</p> <p><u>1</u> 14</p>	<p>PASSENGER SIDE</p> <p>LOCATION OF AIRBAG</p> <p>INSTRUMENT PANEL (GLOVE BOX)</p> <p>EQUIPPED</p> <p>(0) NO (1) YES (4) PRIOR DEPLOYMENT NOT REINSTALLED (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>DEPLOYED</p> <p>(0) NO (1) YES (2) PARTIAL/IMPROPER DEPLOYMENT (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 16</p> <p><u>1</u> 17</p>
<p>CONDITION OF AIRBAG</p> <p>STEERING WHEEL</p> <p>(0) NO DAMAGE (2) SPLIT OR TORN (3) CUT DURING CRASH (4) BURNED/MELTED (5) CUT POST CRASH (6) OTHER _____ (7) DAMAGED, CONDITION UNKNOWN (8) NOT APPLICABLE (NOT EQUIPPED/NOT DEPLOYED) (9) UNKNOWN IF EQUIPPED OR CONDITION</p>	<p><u>⊙</u> 15</p>	<p>CONDITION OF AIRBAG</p> <p>INSTRUMENT PANEL (GLOVE BOX)</p> <p>(0) NO DAMAGE (2) SPLIT OR TORN (3) CUT DURING CRASH (4) BURNED/MELTED (5) CUT POST CRASH (6) OTHER _____ (7) DAMAGED, CONDITION UNKNOWN (8) NOT APPLICABLE (NOT EQUIPPED/NOT DEPLOYED) (9) UNKNOWN IF EQUIPPED OR CONDITION</p>	<p><u>⊙</u> 18</p>
<p>DRIVER SIDE</p> <p>AIRBAG</p> <p>STEERING WHEEL</p> <p>TETHER <i>2 straps</i></p> <p>(0) NO (1) YES (6) OTHER _____ (7) UNKNOWN IF TETHERED (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>MARKED BY CONTACT</p> <p>(0) NO (1) YES (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 19</p> <p><u>⊙</u> 20</p>	<p>PASSENGER SIDE</p> <p>AIRBAG</p> <p>INSTRUMENT PANEL (GLOVE BOX)</p> <p>TETHER <i>1 lg strap</i></p> <p>(0) NO (1) YES (6) OTHER _____ (7) UNKNOWN IF TETHERED (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>MARKED BY CONTACT</p> <p>(0) NO (1) YES (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 21</p> <p><u>⊙</u> 22</p>




AIRBAG NUMBER ON DRIVER SIDE:

NOTE AND DESCRIBE ANY AIRBAG CONTACT OR  
DAMAGE ON DIAGRAM BELOW:

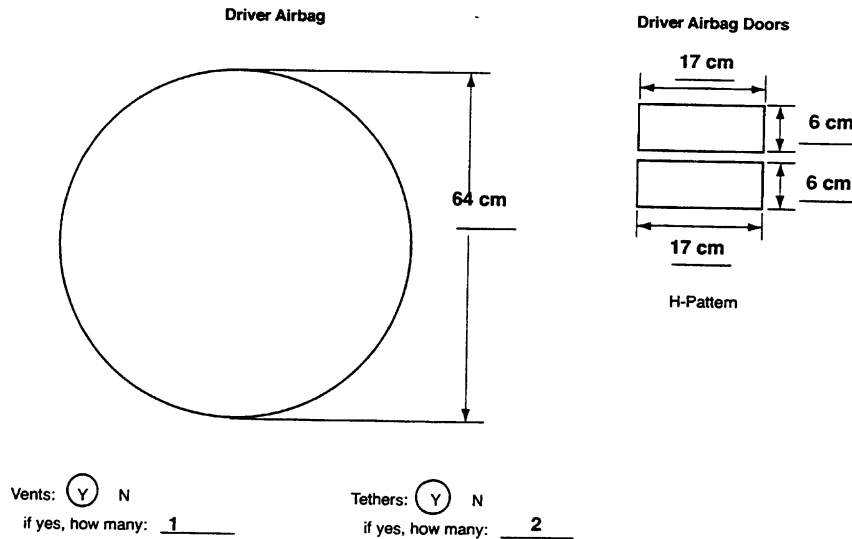

AIRBAG NUMBER ON PASSENGER SIDE:

NOTE AND DESCRIBE ANY AIRBAG CONTACT OR  
DAMAGE ON DIAGRAM BELOW:

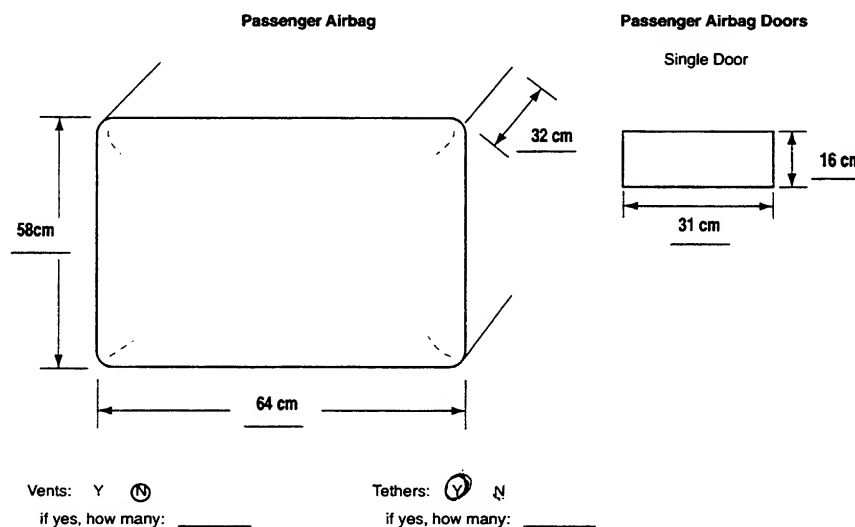

NOTE TO THE INVESTIGATOR:

THE FOLLOWING TWO SECTIONS,  
OCCUPANT INFORMATION AND INJURY CLASSIFICATION,  
ARE TO BE FILLED IN  
FOR EACH CASE VEHICLE OCCUPANT,  
WHETHER INJURED OR NOT.

IF THERE IS MORE THAN ONE OCCUPANT,  
USE ADDITIONAL COPIES  
OF PAGES OC-1, OC-2, OC-3,  
AND IC-2 TO DESCRIBE THEM  
AND ATTACH THE COPIES TO THIS REPORT.

Duplicate columns 1-8  
from the previous card.

Module 0 C Format 0 2  
9 10 11 12

## OCCUPANT INFORMATION OC-1

OCCUPANT IDENTIFICATION		PHYSICAL DESCRIPTION	
OCCUPANT NUMBER	<u>01</u> 13 14	AGE IN YEARS	<u>32</u> 20 21
ROLE OF OCCUPANT AT 1ST IMPACT	<u>1</u> 15	(00) LESS THAN 1 YEAR (98) 98 YEARS OR OLDER (99) UNKNOWN	
(1) MOTOR VEHICLE DRIVER (2) MOTOR VEHICLE PASSENGER (NOT DRIVER) (9) UNKNOWN		AGE IN MONTHS	<u>25</u> 22 23
		(00) LESS THAN 1 MONTH (25) 25 MONTHS OR OLDER (99) UNKNOWN	
OCCUPANT POSITION		MASS (kg)	<u>084</u> 24 25 26
ROW LOCATION	<u>1</u> 16	(999) UNKNOWN	
(1) FRONT (2) SECOND (3) THIRD (4) FOURTH (7) OTHER: _____ (8) EXTERNAL TO PASSENGER COMPARTMENT (E.G. BED OF PICKUP) (9) UNKNOWN		HEIGHT (cm)	<u>180</u> 27 28 29
		(999) UNKNOWN	
LATERAL LOCATION	<u>1</u> 17	SEX	<u>1</u> 30
(1) LEFT (2) LEFT CENTER (3) CENTER (4) RIGHT CENTER (5) RIGHT (6) ALL (LYING ON SEAT) (8) EXTERNAL TO PASSENGER COMPARTMENT (9) UNKNOWN		(1) MALE (2) FEMALE (9) UNKNOWN	
POSTURE	<u>10</u> 18 19	MEDICAL CONDITIONS	
(10) SITTING ON SEAT (11) SITTING ON SEAT IN ABNORMAL POSITION (E.G. FEET ON DASH, SIDEWAYS) (12) SITTING ON CONSOLE (20) ON LAP OR IN ARMS (30) STANDING ON SEAT (40) STANDING ON FLOOR (47) STANDING, EXTERNAL TO PASSENGER COMPARTMENT (50) IN BASSINET (60) IN CHILD SEAT (65) IN CHILD HARNESS (70) LYING ON SEAT (80) LYING/SITTING ON PASSENGER FLOOR (83) LYING/SITTING ON OTHER OBJECT IN PASSENGER COMPARTMENT: _____ (85) ON CARGO FLOOR/FOLDED SEAT-BACK (87) LYING/SITTING, EXTERNAL TO PASSENGER COMPARTMENT (97) OTHER: _____ (99) UNKNOWN		TREATMENT/MORTALITY	<u>04</u> 31 32
		(00) NONE (01) FIRST AID AT SCENE (02) TREATED AT HOSPITAL/CLINIC BUT NOT ADMITTED (03) HOSPITALIZED FOR OBSERVATION LESS THAN 24 HOURS (04) HOSPITALIZED OVER 24 HOURS OR FOR SIGNIFICANT TREATMENT (05) FATAL, DEAD AT SCENE (06) FATAL, DOA (07) FATAL, DEAD WITHIN 24 HOURS (08) FATAL, DEAD 24 HOURS TO 31 DAYS LATER (09) FATAL, DEAD 31 DAYS TO 1 YEAR LATER (10) FATAL DEAD WITHIN UNKNOWN PERIOD (99) UNKNOWN	<u>3 days</u>
		INJURY SEVERITY SCORE (ISS)	<u>06</u> 33 34
		(99) UNKNOWN	
		NON-IMPACT MED. CONDITIONS	<u>0</u> 35
		(0) NONE (1) YES, TIME & TYPE UNKNOWN (2) PRE-CRASH FATAL (CLINICAL DEATH AT WHEEL) (3) PRE-CRASH NON-FATAL (E.G. PRIOR INJURY, STROKE) (4) PREGNANT (5) POST-CRASH FATAL (DROWNING) (6) POST-CRASH NON-FATAL INJURY (7) OTHER: _____ (8) COMBINATION OF ABOVE (CIRCLE EACH) (9) UNKNOWN	

# OCCUPANT INFORMATION OC-2

## MEDICAL CONDITIONS (CONT.)

### POLICE INJURY SEVERITY CODE FOR THIS OCCUPANT

- (0) O - NO INJURY
- (1) C - POSSIBLE INJURY
- (2) B - NON-INCAPACITATING
- (3) A - INCAPACITATING INJURY
- (4) K - FATAL
- (5) INJURED, SEVERITY UNKNOWN
- (6) DIED PRIOR TO IMPACT
- (7) NON-FATAL INJURY,  
SEVERITY UNKNOWN
- (9) UNKNOWN

1  
36

## CHILD SEAT TYPE

- (00) NONE USED
- (01) YES, USED
- (02) INTEGRAL, Chrysler Mini-van
- (88) NOT APPLICABLE  
(ADULT OR OLDER CHILD)
- (99) UNKNOWN

88  
41 42

## CHILD SEAT MAKE/MODEL

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

## RESTRAINT SYSTEM

### ACTIVE RESTRAINT SYSTEM

- (0) NONE
- (1) LAP BELT
- (2) SHOULDER HARNESS ONLY
- (3) BOTH LAP BELT &  
SHOULDER HARNESS
- (9) UNKNOWN

3  
37

### ACTIVE RESTRAINT SYSTEM USAGE

- (0) NONE (AVAILABLE BUT NOT USED)
- (1) LAP BELT ONLY
- (2) SHOULDER HARNESS ONLY
- (3) BOTH LAP BELT &  
SHOULDER HARNESS
- (7) IMPROPER USAGE
- (8) NOT APPLICABLE (NONE AVAILABLE)
- (9) UNKNOWN

3  
38

### PASSIVE RESTRAINT SYSTEM

- (0) NONE
- (1) AIRBAG INSTALLED
- (2) PASSIVE UPPER TORSO  
WITH KNEE BOLSTERS
- (3) PASSIVE UPPER TORSO  
WITHOUT KNEE BOLSTERS
- (4) PASSIVE LAP & UPPER TORSO
- (5) AIRBAG INSTALLED &  
PASSIVE RESTRAINT
- (7) OTHER: \_\_\_\_\_
- (9) UNKNOWN

1  
39

### PASSIVE RESTRAINT SYSTEM USAGE

- (0) SYSTEM DEFEATED
- (1) AIRBAG NOT DEPLOYED
- (2) AIRBAG DEPLOYED
- (3) AIRBAG NOT REINSTALLED
- (4) PASSIVE UPPER TORSO USED
- (5) PASSIVE LAP & UPPER TORSO USED
- (6) SYSTEM USED IN MANUAL MODE
- (7) IMPROPER USAGE
- (8) NOT APPLICABLE (NOT ORIGINALLY  
EQUIPPED)
- (9) UNKNOWN

2  
40

## EJECTION

### DEGREE OF EJECTION

- (0) NONE
- (1) PARTIAL
- (2) COMPLETE
- (7) EJECTED, DEGREE UNKNOWN
- (9) UNKNOWN IF EJECTED

0  
43

### AREA OF EJECTION

- (01) WINDOW, LEFT SIDE
- (02) WINDOW, RIGHT SIDE
- (03) WINDOW, REAR
- (04) DOOR, LEFT SIDE
- (05) DOOR, RIGHT SIDE
- (06) DOOR, REAR OR TAILGATE
- (07) WINDSHIELD
- (08) ROOF OR OPEN CONVERTIBLE OR  
FROM EXTERNAL AREA
- (96) EJECTED AREA UNKNOWN
- (97) OTHER AREA: \_\_\_\_\_
- (98) NOT APPLICABLE (NOT EJECTED)
- (99) UNKNOWN IF EJECTED

98  
44 45

### IF OCCUPANT WAS EJECTED, DESCRIBE IN DETAIL BELOW:

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

## HEAD RESTRAINT

### HEAD RESTRAINT AVAILABLE FOR THIS POSITION


- (0) NOT EQUIPPED OR REMOVED
- (1) EQUIPPED
- (9) UNKNOWN

1  
46

# OCCUPANT INFORMATION OC-3

<p><b>OCCUPANT EYEWEAR</b></p> <p>(0) NONE  (1) GLASSES  (2) CONTACTS  (3) BOTH GLASSES AND CONTACTS  (4) OTHER _____  (8) NOT APPLICABLE  (9) UNKNOWN</p>	<p><u>1</u> 47</p>	<p><b>SOURCE OF INFORMATION</b></p> <p>(0) INTERVIEW  (1) HOSPITAL  (2) AUTOPSY  (3) POLICE  (4) OTHER _____  (5) LAY CORONER/EXTERNAL EXAM  (7) COMBINATION OF ABOVE (CIRCLE)  (8) NOT APPLICABLE  (9) UNKNOWN</p>	<p><u>7</u> 48</p>
--	------------------------	---	------------------------

INDICATE LOCATION OF INJURIES.

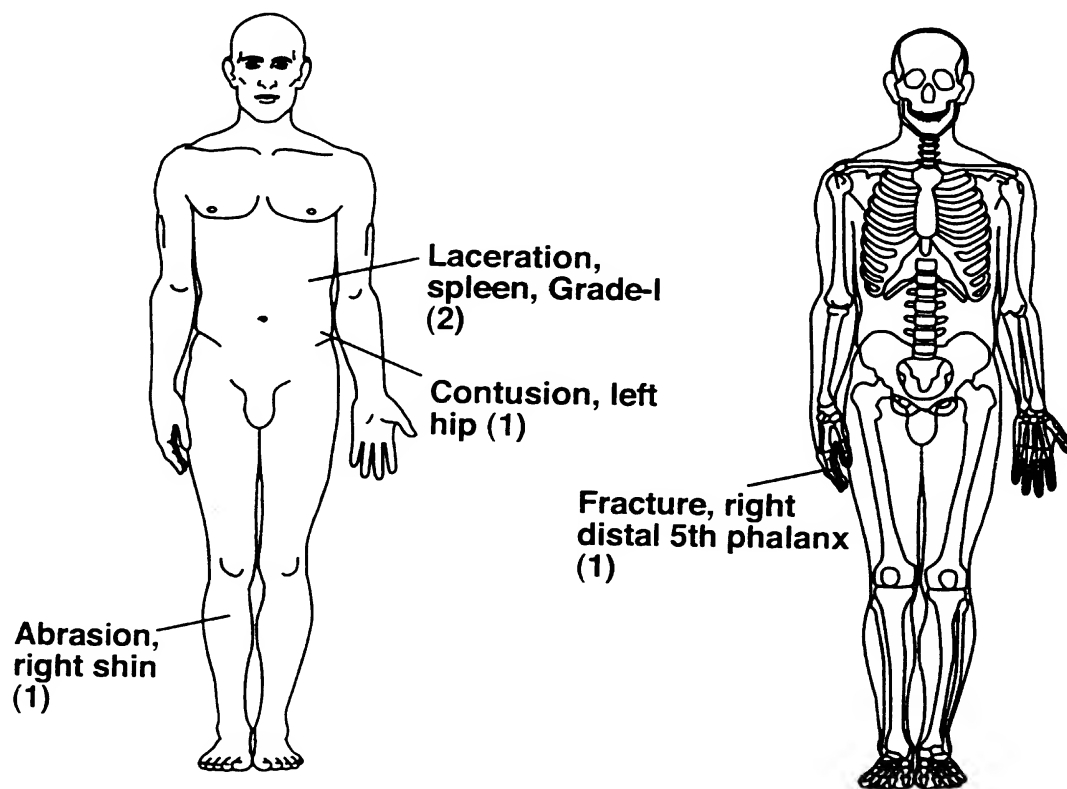

**NOTE:** Each line in the table below is a separate record (card). Duplicate columns 1 - 12 for each completed line.

## OCCUPANT INJURY CLASSIFICATION

[illegible]

**NOTE: USE ADDITIONAL PAGES IF NECESSARY.**

## CODES FOR AREAS OF POSSIBLE OCCUPANT CONTACT

## FRONT OF PASSENGER COMPARTMENT

- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (12) WINDSHIELD
- (05) INSTRUMENT PANEL (*SPECIFIC AREA UNKNOWN*)
- (54) UPPER INSTRUMENT PANEL (X)
- (55) MIDDLE INSTRUMENT PANEL (Y)
- (56) LOWER INSTRUMENT PANEL (Z)
- (81) ASH TRAY (*INSTRUMENT PANEL*)
- (02) GLOVE COMPARTMENT AREA
- (47) AIRBAG (ACRS) COMPARTMENT DOOR/COVER
- (57) BENEATH INSTRUMENT PANEL
- (53) PARCEL TRAY
- (48) KNEE RESTRAINT
- (86) VERTICAL CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (09) STEERING ASSEMBLY (*SPECIFIC AREA UNKNOWN*)
- (65) STEERING WHEEL
- (66) STEERING WHEEL COLUMN
- (59) TRANSMISSION LEVER ON COLUMN
- (03) HARDWARE ITEM (*SPECIFIC AREA UNKNOWN*)
- (82) INSTRUMENT(S)
- (83) CONTROL KNOB(S) & LEVER(S) (*FRONT*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (67) IGNITION KEY
- (06) MIRROR
- (04) HEATER OR AIR CONDITIONING DUCTS
- (01) AIR CONDITIONING OR VENTILATION OUTLET(S)
- (08) RADIO (*BUILT IN*)
- (58) ADD-ON TAPE DECK, RADIO, A/C
- (68) ROOF MOUNTED CONTROLS/CONSOLES

## REAR

- (88) SURFACE OF REAR INTERIOR
- (23) REAR WINDOW
- (39) REAR WINDOW HEADER
- (50) REAR SEAT CUSHION & BACK

## INTERIOR-GENERAL

- (11) TRANSMISSION SELECTION LEVER (*LOCATION UNK.*)
- (59) TRANSMISSION LEVER ON STEERING COLUMN
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (07) PARKING BRAKE HANDLE (*LOCATION UNKNOWN*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (29) FRONT SEAT-BACK(S)
- (51) FRONT SEAT CUSHION
- (50) REAR SEAT CUSHION & BACK
- (49) ARMREST ON SEAT
- (89) UNDER SEAT BOTTOM
- (33) RESTRAINT SYSTEM HARDWARE
- (34) RESTRAINT SYSTEM WEBBING
- (87) AIR CUSHION SKIN (*AIRBAG*)
- (47) AIRBAG (ACRS) COMPARTMENT DOOR/COVER
- (46) AIRBAG GAS
- (48) KNEE RESTRAINT
- (30) HEAD RESTRAINT
- (42) CHILD SEAT RESTRAINTS
- (43) CHILD SEAT
- (31) INTERIOR LOOSE OBJECT
- (32) OTHER OCCUPANT(S)
- (52) INTERNAL FLYING GLASS (*FROM ANY SOURCE*)
- (41) UNKNOWN INTERIOR SURFACE

## SIDES

- (20) SURFACE OF SIDE INTERIOR
- (19) HARDWARE ON SIDE OR DOOR
- (13) ARMREST ON SIDE OR DOOR
- (24) COAT HOOK
- (22) WINDOW GLASS (*SIDE*)
- (21) WINDOW FRAMES (*SIDE*)
- (26) ROOF SIDE RAIL
- (14) A-PILLAR
- (15) B-PILLAR
- (16) C-PILLAR
- (17) D-PILLAR

## FLOOR

- (40) FLOOR
- (27) CONSOLE ON FLOOR OR BETWEEN SEATS
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (91) KICKPANEL

## ROOF

- (25) ROOF OR CONVERTIBLE TOP
- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (26) ROOF SIDE RAIL
- (24) COAT HOOK
- (18) DOME LIGHT
- (39) BACKLIGHT HEADER
- (68) ROOF MOUNTED CONTROLS/CONSOLE
- (69) ROLL BAR

## EXTERIOR SURFACE OF CASE VEHICLE

- (37) OUTSIDE SURFACE OF CASE VEHICLE (*SPECIFIC AREA UNKNOWN*)
- (35) HOOD OF CASE VEHICLE
- (60) EXTERIOR OF CASE VEHICLE (*E.G. OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (62) EXTERIOR SIDE ROOF RAIL OF CASE VEHICLE
- (63) TRUNK LID OF CASE VEHICLE
- (64) TIRES OF CASE VEHICLE

## BEYOND CASE VEHICLE BOUNDARY

- (36) AREA EXTERIOR TO CAR (*SPECIFIC AREA UNK.*)
- (70) HOOD OF OTHER VEHICLE
- (71) OTHER VEHICLE EXTERIOR HARDWARE (*E.G. OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (73) EXTERIOR SIDE ROOF RAIL OF OTHER VEHICLE
- (74) HEADLIGHT OR FRONT GRILL OF OTHER VEH.
- (75) TRUNK OF OTHER VEHICLE
- (76) OUTSIDE SURFACE OF OTHER VEHICLE
- (77) TIRES OF OTHER VEHICLE
- (78) GROUND
- (79) WATER
- (80) EXTERIOR OBJECT (*NOT VEHICLE, GROUND, OR WATER. PLEASE DESCRIBE.*)

## PENETRATING OBJECTS


- (61) OTHER VEHICLE
- (72) OBJECTS (*DESCRIBE*)

## MISCELLANEOUS

- (00) NO CONTACT (*INVALID FIELD FORM CODE*)
- (38) OTHER (*E.G. FIRE. DESCRIBE*)
- (90) SPARE TIRE
- (96) INDUCED
- (97) EJECTED, UNKNOWN CONTACT
- (98) IMPACT FORCE, "WHIPLASH", HYPEREXTENSION/COMPRESSION
- (99) UNKNOWN AREA OF CONTACT



THE FIGURE BELOW  
IS AN EXPLANATION OF THE BODY REGION CODES  
LISTED ON PAGE IC - 4.

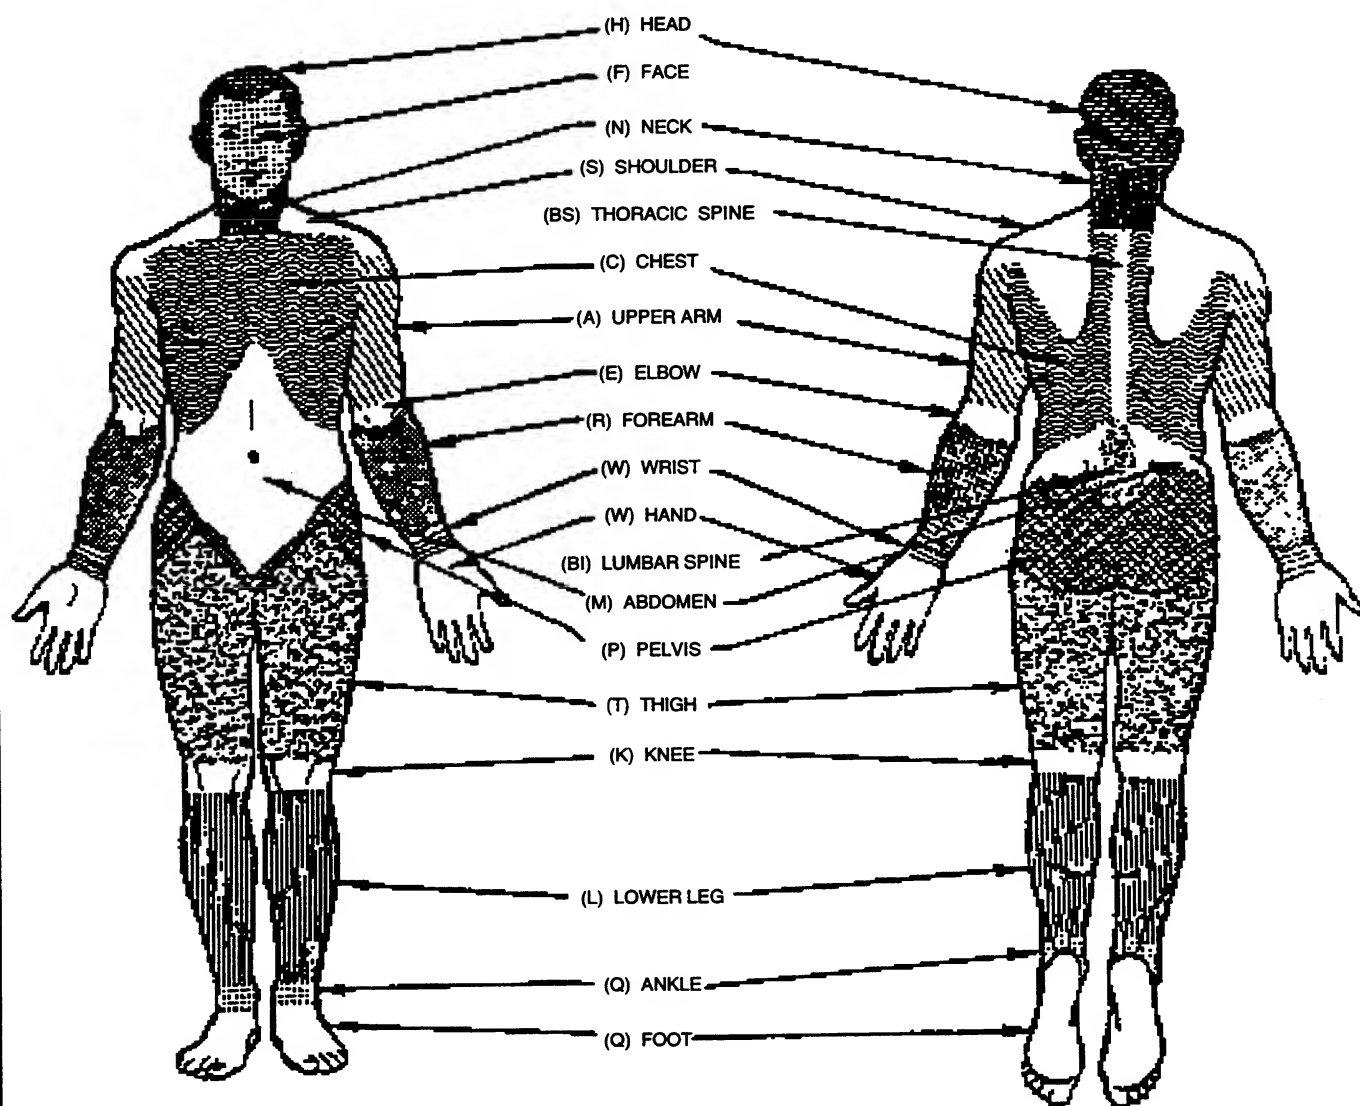

## CODES FOR OCCUPANT INJURY CLASSIFICATION (OIC)

1

BODY REGION

(H) HEAD/SKULL

(F) FACE

(N) NECK

(S) SHOULDER

(X) UPPER EXTREMITIES

(A) ARM (UPPER)

(E) ELBOW

(R) FOREARM

(W) WRIST/HAND

(C) CHEST

(M) ABDOMEN

(B) BACK

(P) PELVIC/HIP

(Y) LOWER EXTREMITIES

(T) THIGH

(K) KNEE

(L) LEG (LOWER)

(Q) ANKLE/FOOT

(O) WHOLE BODY

(U) UNKNOWN

2

ASPECT

(R) RIGHT

(L) LEFT

(B) BILATERAL

(C) CENTRAL

(A) ANTERIOR/FRONT

(P) POSTERIOR/BACK

(S) SUPERIOR/UPPER

(I) INFERIOR/LOWER

(W) WHOLE REGION

(U) UNKNOWN

3

LESION

(L) LACERATION

(C) CONTUSION

(A) ABRASION

(F) FRACTURE

(P) PERFORATION, PUNCTURE

(K) CONCUSSION

(V) AVULSION

(R) RUPTURE

(S) SPRAIN

(D) DISLOCATION

(N) CRUSH

(M) AMPUTATION

(B) BURN

(G) DETACHMENT, SEPARATION

(Z) FRACTURE AND DISLOCATION

(T) STRAIN

(E) TOTAL SEVERANCE, TRANSECTION

(O) OTHER

(U) UNKNOWN

4

SYSTEM/ORGAN

(S) SKELETAL

(V) VERTEBRAE

(J) JOINTS

(D) DIGESTIVE

(L) LIVER

(N) NERVOUS SYSTEM

(B) BRAIN

(C) SPINAL CORD

(E) EARS

(O) EYES

(A) ARTERIES

(H) HEART

(Q) SPLEEN

(G) UROGENITAL

(K) KIDNEYS

(R) RESPIRATORY

(P) PULMONARY/LUNGS

(M) MUSCLES

(T) THYROID, OTHER ENDOCRINE GLAND

(I) INTEGUMENTARY (SKIN)

(W) ALL SYSTEMS IN REGION

(U) UNKNOWN

5

SEVERITY (OR "AIS", ABBREVIATED INJURY SCALE)

(0) NONE

(1) MINOR

(2) MODERATE

(3) SERIOUS

(4) SEVERE

(5) CRITICAL

(6) MAXIMUM

(9) UNKNOWN

BODY REGION

ASPECT

LESION

SYSTEM/ORGAN

SEVERITY

1

2

3

4

5

19 2017 00  
 1800 N 4th Avenue  
 Jettie A. Green section  
 60' year old map  
 1888 George Rein 1800 stock sale 1st pickup  
 2001 George Dekane 4th p trust  
 Dept gen  
 Chas  
 Dry  
 Airport

North

1. 1st right (2nd right) against road



PN 22700 #1



PN 22700 #2



PN 22700 #3



**PN 22700 #4**  
**Best Available**



PN 22700 #5  
Best Available



PN 22700 #6  
Best Available





**PN 22700 #7**  
**Best Available**



**PN 22700 #8**  
**Best Available**



PN 22700 #9



PN22700 #10



PN 22700 #11



PN 22700 #12



PN 22700 #13



PN 22700 #14





PN 22700 #15



PN 22700 # 16



PN 22700 #17




PN 22700 #18




**PN22700 #19**  
**Best Available**



PN 22700 #20

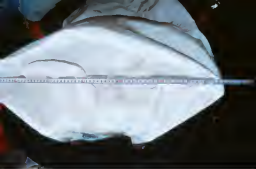

PN 22700 #21  
Best Available

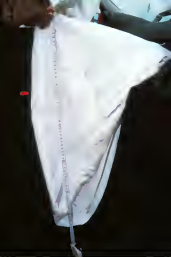

PN 22700 #22  
Best Available





PN 22700#23  
Best Available



PN 22700 #24



PN 22700 #25  
Best Available



PN 22700 #26  
Best Available



PN 22700 #27  
Best Available



PN 22700 #28  
Best Available



PN 22700 #29



PN 22700 830





PN 22700 #31



PN 22700 #32



PN 22700 #33



PN 22700 #34



PN 22700 #35



PN 22700 #36



PN 22700 #37




PN 22700 #38





PN 22700 #39

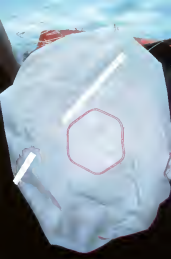

PN 22700 #40



PN 22700 #41



PN 22700 #42



PN 22700-#43



PN 22700 #44

10/10/2000

10/10/2000

10/10/2000

10/10/2000

10/10/2000

10/10/2000

10/10/2000

